

Corporate Identification Number (CIN): L24220MH1945PLC004598

For Shares related queries, email to investor.relations@asianpaints.com

For Consumer queries/complaints/Dealership enquiries email to customercare@asianpaints.com

For HR related queries, email to careers@asianpaints.com

For Media related queries, email to proffice@asianpaints.com



Asian Paints Limited

Plot No. 2602 to 2607 & 2609 to 2614, 2701/A + 2701/B, 2702, 2703

GIDC Industrial Estate, Ankleshwar - 393 002.

Tel: (02646) 678000 | www.asianpaints.com

APL/PAINTS/MoEF/HY/DEC-25

Date: 01.12.2025

To,
Deputy Director General of Forests (C),
Ministry of Environment, Forest and Climate Change,
Integrated Regional Office, Gandhi Nagar A wing- 407 & 409,
Aranya Bhawan, Near CH-3 Circle,
Sector-10A, Gandhinagar-382010
E mail - iro.gandhingr-mefcc@gov.in

Subject: Submission of Half Yearly Environmental compliance status report of Asian Paints Limited, based out of GIDC, Ankleshwar - 393002

Dear Sir,

Enclosed herewith attached is the half yearly EC compliance report for our plant located at Plot no 2602, GIDC Ankleshwar.

The status of Half yearly Compliance against the granted EC, Ref no SEIAA/GUJ/EC/5(h)/597/2018 is attached herewith.

We trust you will find the above in order.

Thanking you.
Yours faithfully,

For ASIAN PAINTS LIMITED

**Authorized Signatory,
ASIAN PAINTS LIMITED
ANKLESHWAR PLANT**

Encl.:As Above

CC.- Regional Office, GPCB, Ankleshwar

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Environment Clearance No.: SEIAA/GUJ/EC/5(h)/597/2018					
Sr. No.	Product	Existing (TPA / KLPA)	Additional quantity (TPA/ KLPA)	Total after expansion (TPA / KLPA)	Remark
1	Phallic Anhydride	29796 TPA	-29796 TPA	0	Complied
2	Light and Heavy ends of phthalic Anhydride	360 TPA	-360 TPA	0	Complied
3	Maleic Acid Solution	4860 TPA	-4860 TPA	0	Complied
4	Paints	130000 KLPA	+170000 KLPA	300000 KLPA	Complied, existing CC&A AWH -139701 quantity for paint production is 2,50,000 KLPA. The total Paint production for the period Apr'25 - Sep'25 was 36,304 KL . The month-wise Production figures are attached as Annexure A.
5	Resins and Emulsion (TSR)	32000 TPA	+53000 TPA	85000 TPA	Complied, existing CC&A AWH -139701 quantity for resin & emulsion (TSR) production is 85,000 TPA. The total Synthetic Resins and Emulsion production for the period Apr'25 - Sep'25 was 10,238 MT . The month-wise Production figures are attached as Annexure A.
A	Conditions				
A.1	Specific conditions				
1	Unit Shall Surrender the Membership certificate of M/s NCTL and ensure that there shall be no wastewater discharge outside the premises				Noted & complied. Unit is maintaining complete ZLD. Connection to underground drainage has been disconnected and a disconnection certificate obtained from Notified Area Authority and No wastewater discharge outside the premises.
2	Complete Zero Liquid Discharge (ZLD) shall be maintained all the time				Complied. Annexure B has been attached herewith as ZLD certificate received from GIDC. Annexure C has been attached herewith as existing effluent treatment plant along with ZLD facility.
3	The spent solvent from production processes shall be recovered by in-house distillation in such a manner that recovery is maximum and recovered solvent shall be reused in the process within premises				Complied, The spent solvent from process is recovered through in-house distillation and recovered solvent is further reused in the process within premises.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

4	Unit shall comply all the conditions & recommendations mentioned in the guidelines for the management of the spent solvents published by GPCB in letter and spirit.	Noted & complied, Unit is complying with the guidelines for the management of the spent solvents published by GPCB.
5	Leak Detection and Repair (LDAR) program shall be prepared and implemented as per the CPCB guidelines	Noted & complied, LDAR Program is prepared as per CPCB Guidelines & it is being followed in plant.
6	Incinerator shall be as per the CPCB Guidelines & proper logbook shall be maintained	Complied, Incinerator is as per CPCB Guidelines & logbook is maintained. For the above span the incinerator was operated for 109 Hrs., complying with legal requirements.
7	Waste generated due to demolition of buildings and other civil structures shall be segregated properly and the Construction and Demolition Waste Management Rules, 2016 shall be followed in letter and spirit	Noted, all civil waste shall be segregated properly and will be disposed of as per the Construction and Demolition Waste Management Rules, 2016.
A.2 WATER		
8	Total water requirement for the project shall not exceed 1300 KL/Day. Unit shall reuse 299.4 KLD of treated water (RO permeate 270 KLD and MEE condensate 29.4 KLD for industrial purpose. Hence, freshwater requirement shall not exceed 1000.6 KL/Day and it shall be met through GIDC water supply only. Prior permission from the concerned authority shall be obtained for withdrawal of water.	Noted & complied, Water consumption of plant will remain within the limit mentioned. During the period of Apr'25 - Sep'25, the maximum freshwater usage was 913 KL/day and average freshwater usage was 313 KL/day & average treated water reused was 20 KL/day .
9	The water meter shall be installed and records of daily and monthly water consumption shall be maintained	Complied, Water meters are provided for measuring and recording quantity of the water consumed at various locations in the plant. Few snapshots of the flow meters are attached as Annexure D.
10	No ground water shall be tapped for the project requirements	Complied, No ground water was tapped for the project requirement.
11	All efforts shall be made to optimize water consumption by exploring Best Available Technology (BAT). The unit shall continuously strive to reduce, recycle and reuse the treated effluent	Noted & complied, All efforts are made to optimize water consumption by exploring Best Available Technology (BAT). Currently, unit reuses the treated effluent in operations and will continue to do so.
12	Industrial waste water generation shall not exceed 138 KL/day	Complied, During the period of Apr'25 - Sep'25, the maximum wastewater generated from Industrial purpose was 34.89 KL/day and the average Industrial wastewater generated was 11.65 KL/day . Annexure E has been attached herewith for reference.
13	Entire quantity of effluent stream shall be treated in proposed ETP (Cap. 300 KL/day) comprises of primary, secondary and tertiary treatment followed by RO system.	Complied, Wastewater generated is being treated in ETP which comprises of primary, secondary and tertiary treatment followed by RO and MEE system.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

14	RO reject stream (30 KLD) shall be subjected to in house MEE - Multiple Effective Evaporator.						Complied, RO reject is being treated in MEE - Multiple Effective Evaporator.
15	RO permeate 270 KLD and MEE condensate 29.4 KLD shall be reused for utilize for industrial purpose.						Complied, RO permeate and MEE condensate are being reused for industrial purposes. During the period of Apr'25 - Sep'25, average 20 KL/day treated water was reused for industrial purpose.
16	Domestic waste water 162 KLD/Day shall be treated along with industrial effluent in ETP and treated waste water shall be reused for gardening and toilet flushing within premises.						Complied, During the period of Apr'25 - Sep'25, the maximum domestic wastewater generated was 80 KL/day and the average domestic wastewater generated was 44 KL/day . Annexure E has been attached herewith. Domestic effluent is being treated in ETP along with industrial effluent and reused for gardening / other purposes.
17	Unit shall provide adequate ETP system along with RO & MEE including stripper and ATFD to achieve Zero Liquid Discharge [ZLD].						Noted & complied, Adequate ETP system along with RO & MEE including ATFD to achieve Zero Liquid Discharge (ZLD) has been maintained. Annexure C has been attached herewith.
18	Unit shall provide buffer water storage tank of adequate capacity for storage of treated waste water during rainy days.						Complied, we are having storage tank to store at least 72 hours of effluent in an impervious acid proof brick lining tank. The snapshot of the same is attached as Annexure F
19	The unit shall provide metering facility at the inlet of the ETP & reuse system and maintain records for the same.						Complied, Flowmeters have been provided at the inlet of ETP, RO & MEE treated water.
20	Proper logbooks of ETP, chemical consumption, quantities and qualities of effluent reuse, power consumption etc. shall be maintained and shall be furnished to the GPCB from time to time.						Complied, the logbook of ETP, quantities and qualities of effluent reuse, power consumption etc. is being maintained and furnished to the GPCB.
21	The unit shall join and participate financially and technically for any common environmental facility / infrastructure as and when the same is taken up either by the GIDC or GPCB or any such authority created for this purpose by the Govt. / GIDC						Noted, we will evaluate and consider the need to join and participate for any common environmental facility / infrastructure as and when the same is taken up either by the GIDC or GPCB.
A.3	AIR						
22	Unit shall not exceed quantity of fuel as mentioned in table as under						
Sr. No.	Stack attached to	Capacity	Stack Height (m)	Type of fuel used	Fuel consumption Kg/hr.)	APCM	Noted & complied, in the plant stack height & fuel consumption are as per the limit mentioned in the existing CC&A AWH -139701.
1	Boiler -1	3 MT/Hr.	33.5	NG	78	Adequate	
2	Boiler - 2	6 MT/Hr.	33.5	NG	156	Stack	
3	DG Set - 1		30	HSD	131	Height	

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

4	DG Set - 2	8 MW each	30	HSD	131	Adequate Stack Height	Annexure G has been attached herewith for the stack emission monitoring summary report for the period of Apr'25 - Sep'25 along with the sample report for the month May'25.
5	DG Set - 3		30	HSD	131		
6	DG Set - 4		30	HSD	131		
7	DG Set - 5		30	HSD	131		
8	DG Set - 6		30	HSD	131		
9	DG Set - 7		30	HSD	131		
10	DG Set - 8		30	HSD	131		
11	Incinerator (APCM with 95 % efficiency)	2 MTPD	30.5	NG	29	Adequate Stack Height and packed bed alkali scrubber	
12	Thermic Heater - 1	2 Lakh Kcal/hr.	36	NG	120	Adequate Stack Height	
13	Thermic Heater - 2	2 Lakh Kcal/hr.	36	NG	120		
14	Thermic Heater - 3	2 Lakh Kcal/hr.	36	NG	120		
15	Thermic Heater - 4	2 Lakh Kcal/hr.	36	NG	120		
16	Thermic Heater - 5	2 Lakh Kcal/hr.	36	NG	120		
17	Thermic Heater - 6	2 Lakh Kcal/hr.	36	NG	120		
23	Unit shall provide adequate stack height / APCM as mentioned in the above table.						Complied, stacks height in the plant is complying to the existing CC&A AWH - 139701. For all additional equipment as part of the expanded capacity, adequate stack height / APCM as mentioned in the above table shall be ensured.
24	Acoustic enclosure shall be provided to the DG sets to mitigate the noise pollution and shall conform to the EPA Rules for air and noise emission standards.						Complied, Acoustic enclosures are provided in the DGs to mitigate the noise pollution and shall conform to the EPA Rules for air and noise emission standards.
25	Stack/Vents of adequate height shall be provided as per the prevailing norms for flue gas emission/Process gas emission						For all equipment stack/vents of adequate height shall be provided as per the prevailing norms for flue gas emission /process gas emission.
26	There shall be no process gaseous emission from the proposed activities						Complied, all necessary equipment / infrastructure provisions are made.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

27	Flue gas emission & Process gas emission (If any) shall conform to the standards prescribed by the GPCB/CPCB/MoEF & CC. At no time, emission level should go beyond the stipulated standards.	Complied. Annexure G has been attached herewith for the stack emission monitoring summary report for the period of Apr'25 - Sep'25 along with the sample report for the month May'25.
28	All the reactors / vessels used in the manufacturing process shall be closed to reduce the fugitive emission	Complied, All the reactors/vessels used in the manufacturing process are closed to reduce the fugitive emission.
29	Measures shall be taken to reduce the process vapors emissions as far as possible. Use of toxic solvents shall be minimum. All venting equipment shall have vapor recovery system. The fugitive emission in the work zone environment shall be monitored. The emission shall conform to the standards prescribed by the concerned authorities from time to time (e.g. Directors of Industrial Safety & Health). Following indicative guidelines shall also be followed to reduce the fugitive emission.	Noted & complied, all possible measures are taken to reduce the process vapors emissions. Use of toxic solvents is minimized, and venting equipment has vapor recovery system. The fugitive emission in the work zone environment is being monitored and is conforming to the standard prescribed by the concerned authorities from time to time.
	1. Internal roads shall be either concreted or asphalted or paved properly to reduce the fugitive emission during vehicular movement	Noted & complied, All the internal roads are of concrete and paved properly to reduce the fugitive emission during vehicular movement.
	2. Air borne dust shall be controlled with water sprinklers at suitable locations in the plant	Noted, Adequate measures shall be provided to control the air borne dust especially during the construction phase of the project.
	3. A green belt shall be developed all around the plant boundary and also along the roads to mitigate fugitive & transport dust emission	Complied, Adequate plantation is already established all along the periphery of the premises.
30	Regular monitoring of Volatile Organic Compounds (VOCs) shall be carried out in the work zone area and ambient air.	Complied, VOCs are being monitored regularly by the MoEF approved lab in the work zone and ambient air. Report is attached as Annexure H.
31	For control of fugitive emission, VOCs, following steps shall be followed	Complied, for control of fugitive emission, closed handling & charging systems are provided for major chemicals and mechanical seals are also provided to prevent leakages.
	1. Closed handling and charging system shall be provided for major chemicals	
	2. Pumps shall be provided with mechanical seals to prevent leakages	
32	Regular monitoring of ground level concentration of PM10, PM2.5, SO2, NOx and VOC shall be carried out in the impact zone and its records shall be maintained. Ambient air quality levels shall not exceed the standards stipulated by the GPCB. If at any stage these levels are found to exceed the prescribed limits, necessary additional control measures shall be taken immediately. The location of the stations and frequency of monitoring shall be decided in consultation with the GPCB	Complied, Ambient Air Quality Monitoring (AAQM) is being adhered to the requirements. Annexure I has been attached herewith in the form of sample AAQM monitoring report by the MoEF approved lab for the month of Apr'25.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

A.4	SOLID / HAZARDOUS WASTES	
33	The company shall strictly comply with the rules and regulations with regards to handling and disposal of Hazardous waste in accordance with the Hazardous and Other Wastes (Management and Transboundary Movement) Rules 2016, as may be amended from time to time. Authorization of the GPCB shall be obtained for collection / treatment / storage / disposal of hazardous wastes.	Complied, Plant complies with the rules and regulations with regards to handling and disposal of Hazardous waste in accordance with the hazardous and Other Wastes (Management and Transboundary Movement) Rules 2016.
34	Hazardous wastes shall be dried, packed and stored in separate designated hazardous waste storage facility with pucca bottom and leachate collection facility, before its disposal	Complied, Hazardous waste is dried, packed and stored in separate designated hazardous waste storage facility with pucca bottom and leachate collection facility, before its disposal in the plant.
35	The unit shall obtain necessary permission from the nearby TSDF site and CHWIF	Complied, Unit has TSDF membership and its certificate has been attached as Annexure J.
36	Oil contaminated with waste water & sludge, Sludge and filters contaminated with oil, Contaminated aromatic, aliphatic or naphthenic solvents, may or may not be fit for reuse, Distillation Residues, Process waste (landfill incinerable), Waste /residues, Waste/residues such as filter aids, Chemical containing residue arising from denomination, Discarded containers/barrels/liners contaminates with hazardous wastes/chemical (linear) incinerable, Spent Ion Exchange Resin containing toxic metals and Oil and Grease skimming residue shall sent to in-house Incinerator or sent to authorized co-processors.	Complied. All categories of waste mentioned are being disposed of as per CC&A AWH - 139701.
37	Spent Carbon shall be return back to supplier for regeneration or sent to in-house Incinerator or sent to authorized co-processors	Noted, Spent Carbon, if generated, shall be returned back to supplier for regeneration or sent to in-house Incinerator or sent to authorized co-processors.
38	Lead Acid Batteries shall be return back to supplier or sent to authorized recyclers as per the Battery Rules 2016	Complied, Lead Acid Batteries are sent to authorized recyclers as per the Battery Rules 2016 & amendments thereafter.
39	Management of Debris and construction waste, Paper waste, Plastic waste, Metal waste, wooden waste, Kitchen waste & Miscellaneous waste shall be as per the provisions of Solid Waste Management Rules, 2016, e-Waste (Management) Rules, 2016, the Construction and Demolition Waste Management Rules, 2016 and the Plastics Waste Management Rules, 2016	Noted, During and post completion of proposed project in the amalgamated plot, management of debris and construction waste, paper waste, plastic waste, metal waste, wooden waste, kitchen waste & miscellaneous waste shall be as per the provisions of Solid Waste management rules, 2016, e waste (Management) Rules, 2016, the Construction and Demolition Waste Management Rules, 2016 and the Plastic Waste Management Rules, 2016.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

40	ETP waste, Discarded Asbestos sheet, Flue gas cleaning residue, Ash from incineration of hazardous waste, shall be disposed off at the nearby common TSDF	Complied, ETP waste, i.e. chemical sludge from wastewater treatment plant is being sent to authorized co-processor and TSDF for landfilling. Discarded Asbestos sheet, Flue gas cleaning residue, Ash from incineration of hazardous waste, are disposed of at the nearby common TSDF in the existing plant. Annexure K has been attached herewith in the form of blue manifest copies for the Chemical sludge disposal done.
41	Discarded barrels/containers/bags/liners shall be either reused or returned back to suppliers or sold only to the actual users authorized by the SPCB	Complied, Discarded barrels / containers / bags / liners are decontaminated, approved by AEPS and sold as Non-Hazardous waste. Haz. Bags / Liners are sent for landfill / co-processing. The same practice shall be continued as per CCA.
42	Used oil shall be sold only to the actual users authorized by the SPCB	Complied, Used oil is sold only to recyclers authorized by the GPCB.
43	Trucks/Tankers used for transportation of hazardous waste shall be in accordance with the provisions under the Motor Vehicle Act, 1988, and rules made there under.	Noted & Complied, Trucks/tankers used for transportation of hazardous waste are in accordance with the provisions under the Motor Vehicle Act, 1988, and rules made there under.
44	The design of the Trucks/tankers shall be such that there is no spillage during transportation	Noted & Complied, The trucks used for transportation of hazardous waste are registered for Haz Waste transportation and designed such that there is no spillage. Same shall be maintained.
45	All possible efforts shall be made for Co-Processing of the Hazardous waste prior to disposal into TSDF/CHWIF	Complied, Waste, which is approved by GPCB for coprocessing, is primarily disposed off through co-processing/Pre-processing method. Annexure L has been attached herewith for the period of Apr'25 - Sep'25. Total 75.37 MT hazardous waste was disposed through coprocessing at cement site/Pre-processing.
46	Management of fly ash (If any) shall be as per the Fly ash Notification 2009 & its amendment time to time and it shall be ensured that there is 100% utilization of fly ash to be generated from the unit	Noted, There is no fly ash generation in the plant.
A.5	SAFETY	
47	The occupier/manager shall strictly comply the provisions under the Factories Act 1948 and the Gujarat Factories Rules 1963	Noted & Complied, Applicable provisions under the Factories Act 1948 and the Gujarat Factories Rules 1963 is complied at the plant.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

48	The project authorities shall strictly comply with the provisions made in Manufacture, Storage and Import of Hazardous Chemicals Rules (MSIHC) 1989, as amended time to time and the Public Liability Insurance Act for handling of hazardous chemicals etc. Necessary approvals from the Chief Controller of Explosives and concerned Govt. Authorities shall be obtained before commissioning of the project. Requisite On-site and Off-site Disaster Management Plans have to be prepared and implemented.	Complied, we are complying with the provisions of the MSIHC rules in terms of the quantities, Storage and Usage of Hazardous chemicals in the plant. Onsite Emergency Plan is available and will be updated to reflect additions & changes in Chemicals stored and infrastructure post proposed expansion. Annexure M has been attached herewith for the compliance report for the period of Apr'25 - Sep'25.
49	First Aid Box shall be made readily available in adequate quantity at all the times	Complied, Adequate number of first aid boxes are available in plant.
50	Main entry and exit shall be separate and clearly marked in the facility.	Complied, The plant has 5 gates for entry and exit & marked clearly.
51	Sufficient peripheral open passage shall be kept in the margin area for free movement of fire tender/ emergency vehicle around the premises	Complied, The plant has sufficient peripheral open passage kept in the margin area for free movement of fire tender/ emergency vehicle around the premises.
52	Storage of flammable chemicals shall be sufficiently away from the production area	Noted & Complied, The plant has storage of flammable chemicals sufficiently away from the production area.
53	Sufficient number of fire extinguishers shall be provided near the plant and storage area	Complied, The plant has enough fire extinguishers and are placed near plant and storage area. Annexure N has been attached herewith in the form of list of fire extinguishers available at site.
54	All necessary precautionary measures shall be taken to avoid any kind of accident during storage and handling of toxic / hazardous chemicals	Noted & Complied, All necessary precautions are taken to avoid any kind of accident during storage and handling of toxic / hazardous chemicals
55	All the toxic/hazardous chemicals shall be stored in optimum quantity and all necessary permissions in this regard shall be obtained before commencing the expansion activities	Noted & Complied, The factory premises has toxic/hazardous chemicals stored in optimum quantity and all necessary permissions in this regard are obtained.
56	The project management shall ensure to comply with all the environment protection measures, risk mitigation measures and safeguards mentioned in the Risk Assessment report.	Noted, All commitments in the Risk Assessment Report shall be complied during the designing of the additional infrastructure going forward.
57	Flame proof electrical fittings shall be provided in flame proof zones or wherever applicable in Plant premises	Complied, Flame proof electrical fittings are available in flame proof zones or wherever applicable in Plant premises in existing plant.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

58	Storage of hazardous chemicals shall be minimized and it shall be in multiple small capacity tanks / containers instead of one single large capacity tank / containers	Noted & Complied, Unit is storing only required quantity of hazardous chemicals and it is stored as per guidelines and necessary licenses.
59	All the storage tanks shall be fitted with appropriate controls to avoid any leakages. Bund/dyke walls shall be provided for storage tanks for Hazardous Chemicals	Complied, the storage tanks are fitted with appropriate controls to avoid leakages. Bund/dyke walls are also provided for storage tanks for Hazardous Chemicals.
60	Handling and charging of the Major chemicals shall be done in closed manner by pumping or by vacuum transfer so that minimal human exposure occurs	Noted & Complied, This aspect of closed loop handling is considered and implemented with an endeavor to minimize human exposure.
61	Tie up shall be done with nearby health care unit / doctor for seeking immediate medical attention in the case of emergency	Complied, the plant has a Health center at Plant with doctor and male nurse. This will continue to serve the purpose. In addition to this, the plant has tied up with nearby hospital (Shreemati Jayaben Mody hospital)
62	Personal Protective Equipment's (PPEs) shall be provided to workers and its usage shall be ensured and supervised.	Complied, Job specific PPE's are provided in the plant and its usage is monitored regularly.
63	First Aid Box and required Antidotes for the chemicals used in the unit shall be made readily available in adequate quantity.	Noted & Complied, Adequate number of first aid boxes with applicable antidotes are available in the existing plant.
64	Training shall be imparted to all the workers on safety and health aspects of chemicals handling.	Complied.
65	Occupational health surveillance of the workers shall be done and its records shall be maintained. Pre-employment and periodical medical examination for all the workers shall be undertaken as per the Factories Act & Rules	Complied, Occupational health surveillance of the workers is carried out once every six months and its records are maintained. Pre-employment and periodical medical examinations for all the workers are also undertaken as per the Factories Act & Rules. Annexure O has been attached herewith in the form of one of the sample medical report conducted in the month of Jun'25.
66	Transportation of hazardous chemicals shall be done as per the provisions of the Motor Vehicle Act & Rules	Noted & Complied, Transportation of hazardous chemical is being done as per the provisions of the Motor Vehicle Act & Rules and will continue to be done.
67	The company shall implement all preventive and mitigation measures suggested in the Risk Assessment Report	Noted & Complied
68	Necessary permissions from various statutory authorities like PESO, Factory Inspectorate and others shall be obtained prior to commissioning of the project	Complied, Prior to commissioning of the project, necessary permissions from various statutory authorities like PESO, Factory Inspectorate and others is obtained.
A.6	Noise	

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

69	The overall noise level in and around the plant area shall be kept well within the standards by providing noise control measures including engineering controls like acoustic insulation hoods, silencers, enclosures etc. on all sources of noise generation. The ambient noise level shall confirm to the standards prescribed under The Environment (Protection) Act, 1986 & Rules.	We are taking adequate measures so that ambient noise level due to our activities conform to the standards prescribed under The Environment (Protection) Act, 1986 & Rules. Annexure P has been attached herewith in the form of six-monthly Noise report conducted in the month of Jul'25.
A.7	CLEANER PRODUCTION AND WASTE MINIMISATION	
70	The unit shall undertake the Cleaner Production Assessment study through a reputed institute / organization and shall form a CP team in the company. The recommendations thereof along with the compliance shall be furnished to the GPCB	Plant has undertaken cleaner production activities.
71	The company shall undertake various waste minimization measures such as	This is being complied with.
	a Metering and control of quantities of active ingredients to minimize waste.	
	b Reuse of by-products from the process as raw materials or as raw materials substitutes	
	c Use of automated and close filling to minimize spillages.	
	d Use of close feed system into batch reactors	
	e Venting equipment through vapor recovery system	
	f Use of high pressure hoses for cleaning to reduce wastewater generation	
	g Recycling of washes to subsequent batches	Complied, In existing plant, wash water generated during cleaning of vessels is reused back in the subsequent batches thereby reducing the consumption of fresh water in the product and hydraulic load to ETP. MTO used for cleaning is being reused in subsequent batches.
	h Recycling of steam condensate	Noted & Complied, Steam Condensate is being recycled in existing plant. Same shall also be recycled in amalgamated Plant post completion.
	i Sweeping / mopping of floor instead of floor washing to avoid effluent generation.	Noted & Complied, In plant, floor is swept/mopped as a good practice and same shall be maintained in the amalgamated unit
	j Regular preventive maintenance for avoiding leakage, spillage etc.	Noted.
A.8	GREEN BELT AND OTHER PLANTATION	

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

72	The unit shall develop green belt within premises as per the CPCB guidelines. However, if the adequate land is not available within the premises, the unit shall take up adequate plantation on road sides and suitable open areas in GIDC estate or any other open areas in consultation with the GIDC / GPCB and submit an action plan of plantation for next three years to the GPCB.	Complied. Green Belt is developed within premises. Current green belt area inside plant is 13516 Sq. mt. Also, in association with the Forest Department (Govt of Gujarat), we have developed a green belt on 9.9 acres of forest land using the concept of social forestry.
73	Drip irrigation / low-volume, low-angle sprinkler system shall be used for the green belt development within the premises	Notes, Same is being taken as design input and shall comply after proposed expansion.
B	OTHERS CONDITIONS	
74	All the recommendations, mitigation measures, environmental protection measures and safeguards proposed in the EIA report of the project prepared by M/s: Kadam Environmental Consultants, Vadodara was submitted by project proponent vide letter no. NIL dated 11/09/2017 and commitments made during presentation before SEAC and proposed in the EIA report shall be strictly adhered to in letter and spirit.	Noted & Complied, Commitments made during presentation before SEAC and proposed in the EIA report shall be adhered to in the amalgamated plot during and after completion of expansion project.
75	Rain water harvesting of surface as well as rooftop runoff shall be undertaken, and the same water shall be used for the various activities of the project to conserve fresh water as well as to recharge ground water. Before recharging the surface run off, pre-treatment must be done to remove suspended matter.	Noted & Complied, Roof top Rainwater harvesting structure will be installed and collected water will be reused inside factory operations, post completion of the expansion project.
76	The unit shall join and participate financially and technically for any common environmental facility / infrastructure as and when the same is taken up either by the Industrial Association or GIDC or GPCB or any such authority created for this purpose by the Govt. / GIDC.	Noted, Unit will evaluate and consider the need to join and participate for any common environmental facility / infrastructure as and when the same is taken up either by the GIDC or GPCB.
77	Application of solar energy shall be incorporated for illumination of common areas, lighting for gardens and street lighting in addition the provision for solar water heating system shall also be provided.	Complied, Solar Energy is used at Plant for illumination of common areas. Details are attached as Annexure Q. Provision for Solar Water Heating will be explored for need and feasibility.
78	The area earmarked as green area shall be used only for plantation and shall not be altered for any other purpose.	Noted and complied.
79	All the commitments / undertakings given to the SEAC during the appraisal process for the purpose of environmental protection and management shall be strictly adhered to.	Noted & Complied, All the commitments / undertakings given to the SEAC during the appraisal process for the purpose of environmental protection and management shall be adhered in the amalgamated plot during and after completion of project.
80	The project proponent shall also comply with any additional condition that may be imposed by the SEAC or the SEIAA or any other competent authority for the purpose for the environmental protection and management.	Noted & Complied, This will be complied during and after commissioning of project in amalgamated plot

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

81	In the event of failure of any pollution control system adopted by the unit, the unit shall be safely closed down and shall not be restarted until the desired efficiency of the control equipment has been achieved.	Noted.
82	The project authorities must strictly adhere to the stipulations made by the Gujarat Pollution Control Board (GPCB), State Government and any statutory authority.	Noted.
83	During material transfer there shall be no spillages and garland drain shall be constructed to avoid mixing of accidental spillages with domestic wastewater or storm water.	Noted & Complied, Plant has provisions for material transfer whereby eliminating the chances of spillage. Adequate measures shall be taken up to avoid mixing of accidental spillage with domestic wastewater or storm water
84	Pucca flooring / impervious layer shall be provided in the work areas, chemical storage areas and chemical handling areas to minimize soil contamination.	Complied, Pucca flooring / impervious layer is provided in the work areas, chemical storage areas and chemical handling areas to minimize soil contamination.
85	Leakages from the pipes, pumps, shall be minimal and if occurs, shall be arrested promptly.	Noted & Complied, Provisions are made in the plant so that leakages from Pipes, Pumps are minimum.
86	No further expansion or modifications in the plant likely to cause environmental impacts shall be carried out without obtaining prior Environment Clearance from the concerned authority.	Noted, No further expansion or modifications likely to cause environmental impacts shall be carried out without obtaining prior Environment Clearance from SEIAA.
87	The above conditions will be enforced, inter-alia under the provisions of the Water (Prevention & Control of Pollution) Act, 1974, Air (Prevention & Control of Pollution) Act, 1981, the Environment (Protection) Act, 1986, Hazardous Wastes (Management, Handling and Transboundary Movement) Rules, 2008 and the Public Liability Insurance Act, 1991 along with their amendments and rules.	Noted, Unit post expansion shall comply with all the above conditions enforced.
88	The project proponent shall comply all the conditions mentioned in "The Companies (Corporate Social Responsibility Policy) Rules, 2014" and its amendments from time to time in a letter and spirit.	Noted, Asian Paints company is complying to "The Companies (Corporate Social Responsibility Policy) Rules, 2014" and its amendments, and is utilizing the funds earmarked for the benefit of society. The company will continue to comply in future as well.
89	The project management shall ensure that unit complies with all the environment protection measures, risk mitigation measures and safeguards recommended in the EMP report and risk Assessment study report as well as proposed by project proponent.	Noted, Unit is following all the environment protection measures, risk mitigation measures and safeguards recommended in the EMP report and risk Assessment study report as well as proposed by the Factory Management.
90	The project authority shall earmark adequate funds to implement the conditions stipulated by SEIAA as well as GPCB along with the implementation schedule for all the conditions stipulated herein. The funds so provided shall not be diverted for any other purpose.	Noted, Adequate funds shall be earmarked to implement the conditions stipulated by SEIAA as well as GPCB during execution of project at amalgamated plot.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

91	The applicant shall inform the public that the project has been accorded environmental clearance by SEIAA and that the copies of the clearance letter are available with the GPCB and may also be seen in the Website of SEIAA/SEAC/GPCB. This shall be advertised within seven days from the date of the clearance letter, in at least two local newspapers that are widely circulated in the region, one of which shall be in the Gujarati language and the other in English. A copy of each of the same shall be forwarded to the Regional Office of the Ministry.	Complied, The advertisement in local newspapers, in English and Gujarati, regarding grant of EC by SEIAA has been published. Scanned copy of the newspaper is attached as Annexure R.
92	The project proponent shall also comply with any additional condition that may be imposed by the SEAC or the SEIAA or any other competent authority for the purpose for the environmental protection and management.	Noted, any additional condition that may be imposed by the SEAC or the SEIAA or any other competent authority for the purpose for environmental protection and management shall be complied with.
93	It shall be mandatory for the project management to submit half yearly compliance report in respect of the stipulated prior environmental clearance terms and conditions in hard copy and soft copies to the regulatory authority concerned, on 1st June and 1st December of each calendar year.	Complied, Half yearly compliance with respect to EC conditions are being submitted regularly.
94	Concealing factual data submission of false/fabricated data and failure to comply with any of the conditions mentioned above may result in withdrawal of this clearance and attract action under the provisions of Environment (Protection) Act, 1986.	Noted, correct factual data is being submitted by the existing unit and same shall be continued post expansion.
95	The project authorities shall also adhere to the stipulations made by the Gujarat Pollution Control Board.	Noted, stipulations made by the Gujarat Pollution Control Board shall be complied to.
96	The SEIAA may revoke or suspend the clearance, if implementation of any of the above conditions is not found satisfactory.	Noted, conditions mentioned above shall be implemented.
97	The company in a time-bound manner shall implement these conditions. The SEIAA reserves the right to stipulate additional conditions, if the same is found necessary.	Noted.
98	The project authorities shall inform the GPCB, Regional Office of MoEF and SEIAA about the date of financial closure and the final approval of the project by the concerned authorities and the date of issue.	Noted.
99	The environment clearance is valid for seven years from the date of issue.	Noted
100	Any appeal against this environmental clearance shall lie with the National Green Tribunal, if preferred, within a period of 30 days as prescribed under Section 16 of the National Green Tribunal Act, 2010.	Noted.
101	Submission of any false or misleading information or data which is material to screening or scoping or appeal or decision on the application makes this environmental clearance cancelled.	Noted.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

INDEX

Sr.No.	LIST OF ANNEXURES	REFERENCE DETAIL
1	Annexure A	Production details
2	Annexure B	ZLD Certificate from GIDC
3	Annexure C	ETP Layout diagram with ZLD facility
4	Annexure D	Snap of Flow meters
5	Annexure E	Trade and Domestic effluent generation data
6	Annexure F	Storage tank snap for 72 hrs. period
7	Annexure G	Stack analysis report
8	Annexure H	VOC analysis report
9	Annexure I	AAQM monitoring report
10	Annexure J	TSDF membership certificate
11	Annexure K	Manifest copies for hazardous waste disposal
12	Annexure L	Haz waste coprocessing data
13	Annexure M	MSIHC data
14	Annexure N	List of fire extinguishers
15	Annexure O	Half Yearly Medical Report
16	Annexure P	Six monthly noise report
18	Annexure Q	Solar data
19	Annexure R	Scan of EC advertisement in newspaper

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure A

Production details

Year	Total Paint Production (KL)	Synthetic Resins and Emulsions (MT)
2025-26	36304	10238
Month	Total Paint Production (KL)	Synthetic Resins and Emulsions (Mt)
Apr-25	6021	1833
May-25	5658	1696
Jun-25	5879	1721
Jul-25	5645	1486
Aug-25	5969	1638
Sep-25	7133	1864
Total	36304	10238

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure B

ZLD Certificate from GIDC

NOTIFIED AREA OFFICE (GUJARAT INDUSTRIAL DEVELOPMENT CORPORATION)

Office of the Dy. Executive Engineer (Drainage)
Plot No. 016/519, AIA Community Centre,
GIDC, Ankleshwar-393 002.
Phone : 02646-251359
Fax : 02646-251750


Our Ref. No. : N.A./ANK/DEE/DRG/503

Date : 6 JUL 2018

CERTIFICATE

To whom so ever it may concern

This is to certify that M/s. Asian Paints Ltd; Plot No: 2602 at GIDC, Ankleshwar is now Zero Liquid Discharge Unit. The Drainage connection of this unit has been disconnected on dtd. 06-07-2018. At present this unit is not having any underground drainage connection to GIDC drainage network.


Dy. Ex-Engineer (Drg & Road)
N.A, GIDC, Ankleshwar.

To,
M/s. Asian Paints Ltd.
Plot No: 2602,
GIDC, Ankleshwar

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

NOTIFIED AREA OFFICE (GUJARAT INDUSTRIAL DEVELOPMENT CORPORATION)

Office of the Dy. Executive Engineer (Drainage)
Plot No. 618/619, AIA Community Centre,
GIDC, Ankleshwar-393 002.
Phone : 02646-251359
Fax : 02646-251753


Our Ref. No. : N.A./ANK/DEE/DRG/1071.

Date : 27 Dec 2019

CERTIFICATE

TO WHOM SO EVER IT MAY CONCERN

This is to certify that M/s. Asian Paints Ltd(Phthalic Division);
Plot No: 2702 at GIDC, Ankleshwar has applied to GPCB for Zero Liquid
Discharge. The Drainage connection of this unit has been disconnected
on dtd. 20-12-2019. At present this unit is not having any underground
drainage connection to GIDC drainage network.


Dy.Ex.Engineer (Drg & Road)
N.A, GIDC, Ankleshwar.

To,
M/s. Asian Paints Ltd.(Phthalic Division)
Plot No: 2702,
GIDC, Ankleshwar

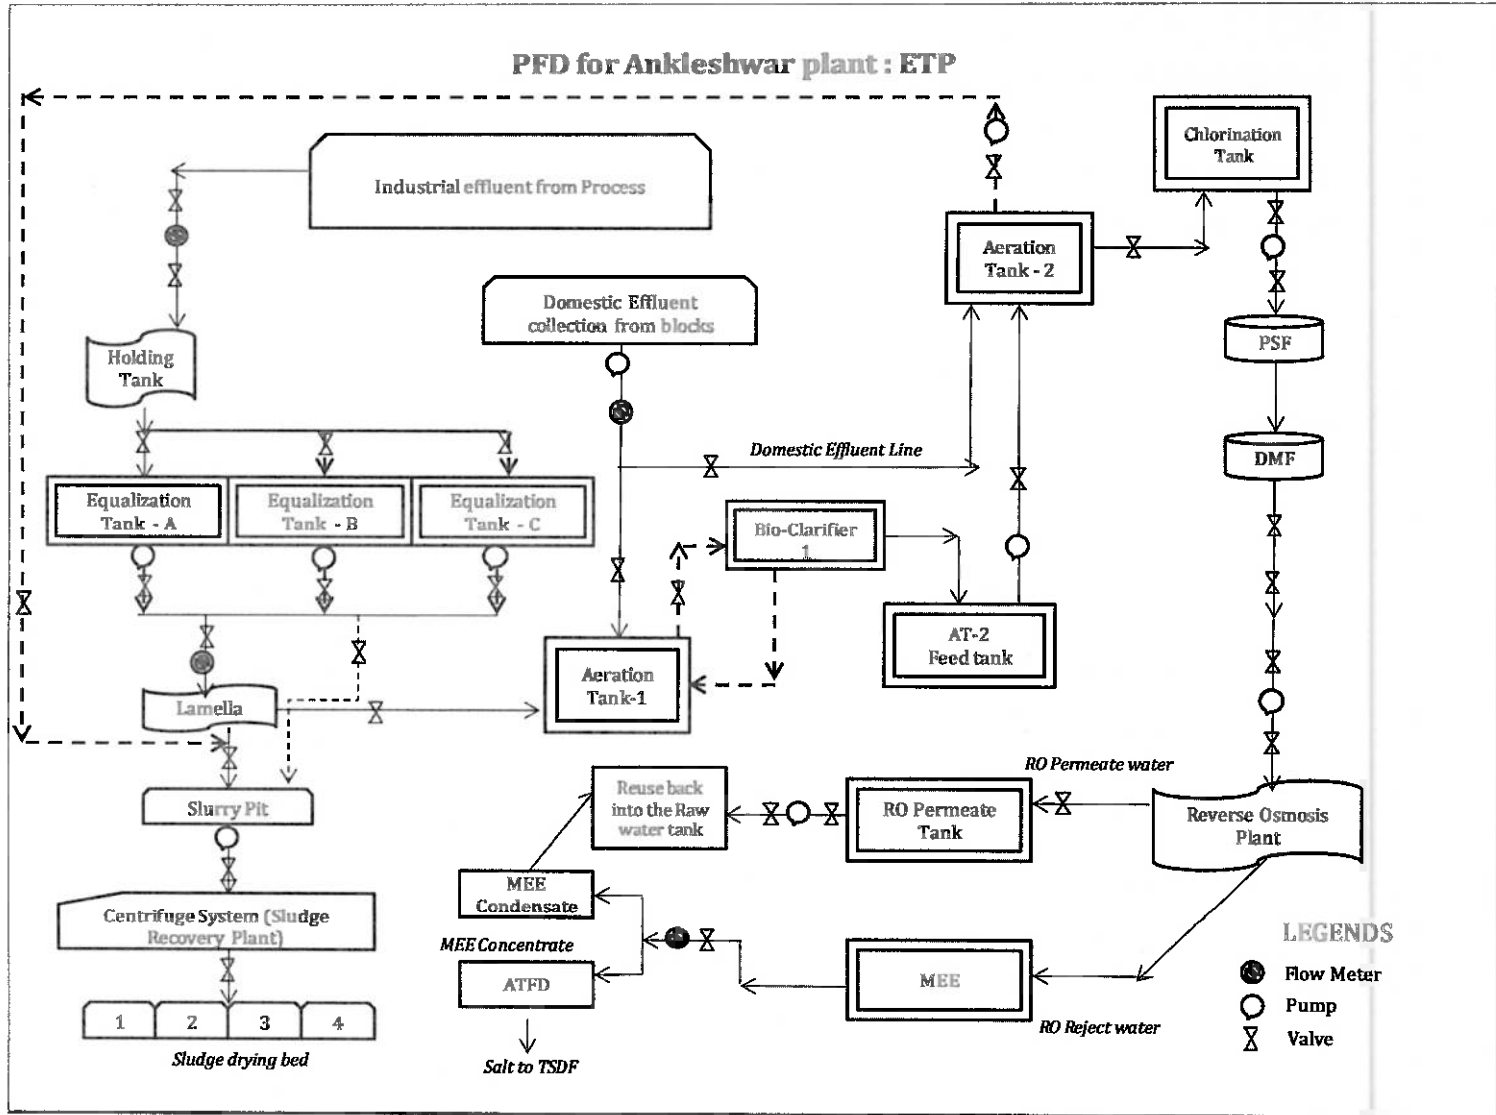
Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure C

ETP Layout diagram with ZLD facility



Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

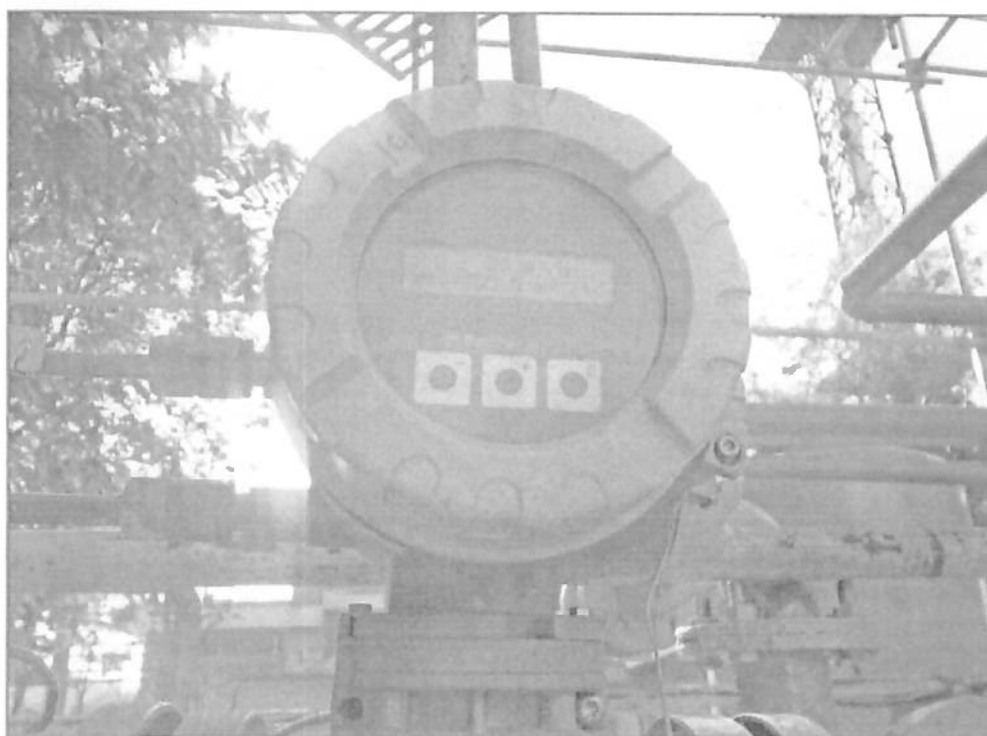
ETP capacity details		
S. No.	Tank Capacity	Capacity
1	Equalization Tank - A	32 KL
2	Equalization Tank - B	32 KL
3	Equalization Tank - C	28 KL
4	Aeration Tank - 1	90 KL
5	Bio Clarifier - 1	17 KL
6	Aeration Tank 2 cum bio clarifier	360 KL
7	Chlorination tank	6 KL
8	Pressure sand filter (Rate of filtration)	11.05 m ³ /m ² .h
9	Activated Carbon filter (Rate of filtration)	11.05 m ³ /m ² .h
10	Slurry Pit	7.8 KL
11	Centrifuge	5 m ³ /hr
12	ETP Treated water Storage Tank	20 KL
13	RO Plant Feed Tank	100 KL
14	RO Plant	180 m ³ /Day
15	MEE Plant Feed tank	110 KL
16	MEE Plant	1.5 KL/hr
17	RO Permeate tank	10 KL
18	MEE Condensate Tank	20 KL
19	Sludge Drying Bed - 1	18.9 KL
20	Sludge Drying Bed - 2	18.9 KL
21	Sludge Drying Bed - 3	18.9 KL
22	Sludge Drying Bed - 4	18.9 KL

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure D

Snap of Flow meters



Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure E

Trade and Domestic effluent generation data

Date	Apr-25		May-25		Jun-25	
	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)
1	27	10	45	16	37	0
2	31	14	40	11	60	8
3	15	15	38	10	40	17
4	30	10	20	6	38	8
5	38	17	38	29	39	9
6	25	11	45	21	38	12
7	25	21	43	12	37	12
8	39	12	55	5	41	15
9	42	13	45	17	41	22
10	36	26	34	18	41	6
11	28	14	20	19	34	16
12	39	8	48	13	41	14
13	9	8	44	11	35	12
14	40	9	45	21	40	12
15	49	35	48	10	41	4
16	40	15	33	13	42	14
17	43	22	42	6	47	11
18	48	15	33	4	53	17
19	28	17	30	25	51	11
20	47	14	35	11	59	15
21	45	12	56	5	54	12
22	44	13	41	11	65	6
23	39	8	56	12	65	7
24	27	6	60	21	56	11
25	38	11	42	10	62	6
26	48	4	41	6	80	14
27	34	12	47	15	23	1
28	37	16	55	6	26	11
29	38	17	53	4	51	17
30	45	7	52	14	53	3
31	-	-	50	10	-	-
Max	49	35	60	29	80	22
Min	9	4	20	4	23	0
Avg	36	14	43	13	46	11
CCA Limit	112	68	112	68	112	68

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,

GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

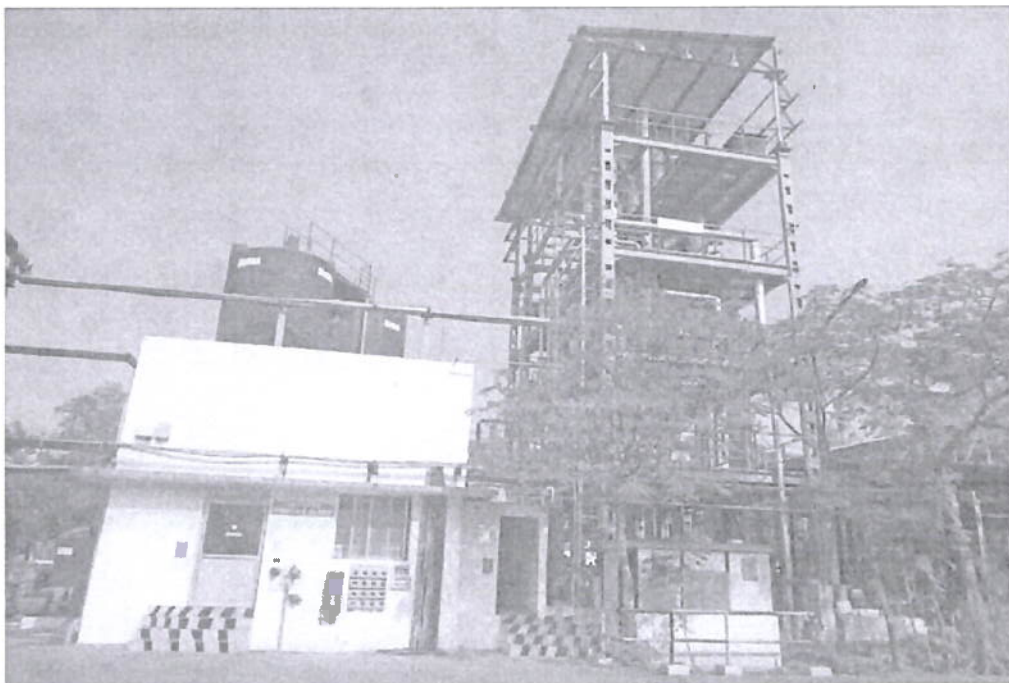
Date	Jul-25		Aug-25		Sep-25	
	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)	DOMESTIC EFFLUENT (KLD)	INDUSTRIAL EFFLUENT (KLD)
1	38	27	71	5	46	11
2	42	17	12	7	34	11
3	33	11	26	13	69	15
4	58	11	47	17	13	12
5	54	9	37	9	40	4
6	65	10	38	14	47	9
7	23	10	46	16	56	11
8	34	17	47	12	69	25
9	1	11	23	0	45	14
10	55	7	13	18	43	15
11	54	12	51	17	49	13
12	69	11	43	1	46	7
13	44	6	47	16	38	14
14	41	9	47	22	31	18
15	53	12	28	0	34	6
16	47	12	12	0	42	6
17	46	13	46	20	62	0
18	62	9	39	12	27	15
19	26	11	54	19	49	10
20	46	0	56	21	52	4
21	66	12	60	8	34	0
22	60	5	60	19	53	8
23	31	12	45	10	37	17
24	0	18	52	9	47	4
25	48	8	59	15	42	8
26	59	9	69	11	49	11
27	61	3	60	15	38	2
28	67	8	50	17	61	17
29	56	5	56	10	57	4
30	54	17	63	5	47	7
31	40	13	66	13	-	-
Max	69	27	71	22	9	0
Min	0	0	12	0	13	0
Avg	46	11	46	12	45	10
CCA Limit	112	68	112	68	112	68

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure F

Storage tank snap for 72 hrs. period



Guard pond of 380 KL capacity and underground storage tanks below the RO and MEE facilities with 100KL Storage each

Total Capacity is $380+100+100 = 580$ KL against the requirement of 540 KL (3 days*180 KL/day)

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure G

Stack analysis report

Stack Sample details	Parameters	UOM	CCA Limit	Apr-25	May-25	Jun-25	Jul-25	Aug-25	Sep-25
Incinerator Stack	Particulate Matter	mg/Nm3	40	26.10	29.70	26.33	28.42	25.62	28.42
	Sulfur Dioxide as SO2	mg/Nm3	160	57.90	54.20	16.88	18.47	15.74	17.79
	Oxides of Nitrogen as NOX	mg/Nm3	320	106.00	109.00	42.37	45.82	38.65	42.84
	Hydrochloric Acid as HCl	mg/Nm3	40	12.10	14.60	5.34	6.34	5.84	6.54
	Carbon Monoxide as CO	mg/Nm3	80	14.30	16.10	13.74	16.03	13.74	16.03
	Hydrogen Fluoride as HF	µgm/m3	3.2	1.02	1.08	1.98	2.26	1.97	1.68
	Organic Content-TOC	mg/l	16	ND	ND	ND	ND	ND	ND
	Lead as Pb	mg/l	0.4	0.210	0.280	0.156	0.184	0.162	0.176
	Total Dioxin and Furans	ng/NM3	0.08	-	-	0.0004	-	-	-
	Temperature of Flue Gas	°C	NS*	72.00	78.00	66.00	58.00	56.00	58.00
	Velocity of flue Gas	m/sec	NS*	6.36	6.42	5.42	5.46	5.62	5.54
	Oxygen as O2	%	NS*	9.20	9.60	10.80	10.60	10.80	10.60
	Volumetric Flow Rate of Gas	Nm3/hr	NS*	5430	5230	5573	5612	5808	5739
IBR Boiler Stack	Temperature of Flue Gas	oC	NS*	Not operated	Not operated	Not operated	Not operated	Not operated	Not operated
	Velocity of flue Gas	m/sec	NS*						
	Particulate Matter	mg/Nm3	120						
	Sulfur Dioxide as SO2	ppm	80						
	Oxides of Nitrogen as NOX	ppm	40						
	Volumetric Flow Rate of Gas	m3/sec	NS*						
	Carbon Dioxide as CO2	mg/kg	NS*						
	Oxygen as O2	mg/kg	NS*						
	Carbon Monoxide as CO	mg/kg	NS*						
Thermo Pack TP 1 (1 & 2)	Temperature of Flue Gas	oC	NS*	Not operated	Not operated	110	116	117	119
	Velocity of flue Gas	m/sec	NS*			6.41	6.56	6.42	6.55
	Particulate Matter	mg/Nm3	120			ND	ND	ND	ND
	Sulfur Dioxide as SO2	ppm	80			5.84	6.8	4.9	5.9
	Oxides of Nitrogen as NOX	ppm	40			26.47	28.3	27.3	30.8
	Volumetric Flow Rate of Gas	m3/sec	NS*			1.26	1.22	1.28	1.26
	Carbon Dioxide as CO2	mg/kg	NS*			59400	61200	59400	61200
	Oxygen as O2	mg/kg	NS*			204204	198968	198063	198968
	Carbon Monoxide as CO	mg/kg	NS*			ND	ND	ND	ND
Thermo Pack TP 2 (3 & 4)	Temperature of Flue Gas	oC	NS*	Not operated	113	Not operated	Not operated	Not operated	Not operated
	Velocity of flue Gas	m/sec	NS*		6.44				
	Particulate Matter	mg/Nm3	120		ND				
	Sulfur Dioxide as SO2	ppm	80		5.11				
	Oxides of Nitrogen as NOX	ppm	40		25.13				
	Volumetric Flow Rate of Gas	m3/sec	NS*		1.26				
	Carbon Dioxide as CO2	mg/kg	NS*		59400				
	Oxygen as O2	mg/kg	NS*		202895				
	Carbon Monoxide as CO	mg/kg	NS*		ND				

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

DG SET - 1 - GEN A 601 (320 KVA) - GATE 1	Temperature of Flue Gas	oC	NS*	144	142	146	145	134	132
	Velocity of flue Gas	m/sec	NS*	8.68	8.56	8.41	8.26	8.24	8.55
	Particulate Matter	mg/Nm3	120	22.47	18.4	21.59	20.8	25.64	23.42
	Sulfur Dioxide as SO2	ppm	80	5.58	9.2	6.56	5.9	6.32	5.5
	Oxides of Nitrogen as NOX	ppm	40	24.36	26.9	25.53	26.3	25.66	24.31
	Volumetric Flow Rate of Gas	m3/sec	NS*	0.27	0.26	0.26	0.24	0.26	0.27
	Carbon Dioxide as CO2	mg/kg	NS*	75600	75600	79200	75600	75600	79200
	Oxygen as O2	mg/kg	NS*	212058	210749	213367	210749	210749	212058
	Carbon Monoxide as CO	mg/kg	NS*	ND	ND	ND	ND	ND	ND
DG SET - 3 - GEN A 603 (320 KVA) - GATE 1	Temperature of Flue Gas	oC	NS*	140	138	136	133	130	134
	Velocity of flue Gas	m/sec	NS*	8.24	8.28	8.56	8.44	8.62	8.24
	Particulate Matter	mg/Nm3	120	21.53	19.2	20.4	21.9	20.31	22.33
	Sulfur Dioxide as SO2	ppm	80	6.58	5.8	7.27	6.8	5.87	6.27
	Oxides of Nitrogen as NOX	ppm	40	27.69	26.2	25.45	28.4	24.43	22.49
	Volumetric Flow Rate of Gas	m3/sec	NS*	0.26	0.25	0.27	0.25	0.27	0.26
	Carbon Dioxide as CO2	mg/kg	NS*	79200	81000	77400	77400	73800	75600
	Oxygen as O2	mg/kg	NS*	213367	214676	212058	212058	213367	218603
	Carbon Monoxide as CO	mg/kg	NS*	ND	ND	ND	ND	ND	ND
DG SET - 4 - GEN A 610 (500 KVA) - GATE 1	Temperature of Flue Gas	oC	NS*	125	127	122	125	114	116
	Velocity of flue Gas	m/sec	NS*	7.82	7.68	7.55	7.58	7.55	7.25
	Particulate Matter	mg/Nm3	120	26.43	24.2	22.4	23.8	22.62	19.43
	Sulfur Dioxide as SO2	ppm	80	6.28	6.4	5.38	6.8	5.72	6.44
	Oxides of Nitrogen as NOX	ppm	40	26.57	23.2	27.51	29.5	26.32	25.66
	Volumetric Flow Rate of Gas	m3/sec	NS*	0.25	0.26	0.24	0.26	0.24	0.23
	Carbon Dioxide as CO2	mg/kg	NS*	77400	73800	81000	75600	75600	81000
	Oxygen as O2	mg/kg	NS*	217294	215985	213367	214676	214676	213367
	Carbon Monoxide as CO	mg/kg	NS*	ND	ND	ND	ND	ND	ND
DG SET - 5 - GEN A 609 (1250 KVA) - GATE 1	Temperature of Flue Gas	oC	NS*	136	138	134	135	122	126
	Velocity of flue Gas	m/sec	NS*	8.35	8.26	8.03	7.88	8.61	8.46
	Particulate Matter	mg/Nm3	120	20.33	16.4	21.47	18.5	25.59	21.43
	Sulfur Dioxide as SO2	ppm	80	5.51	5.9	6.16	5.7	6.51	5.25
	Oxides of Nitrogen as NOX	ppm	40	22.64	21.3	24.43	26.8	24.61	23.59
	Volumetric Flow Rate of Gas	m3/sec	NS*	0.8	0.78	0.77	0.72	0.83	0.81
	Carbon Dioxide as CO2	mg/kg	NS*	73800	81000	77400	81000	86400	82800
	Oxygen as O2	mg/kg	NS*	212058	213367	214676	210749	213367	214676
	Carbon Monoxide as CO	mg/kg	NS*	ND	ND	ND	ND	ND	ND

Note: NS* - NOT SPECIFIED, ND* - NOT DETECTED

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/20-ST

Page: 1 of 1

Customer's Name and Address :

M/S. ASIAN PAINTS LIMITED
PLOT NO.:2702, GIDC,
ANKLESHWAR – 393 002.

Test Report No. : **PL/APA/25/05/0001**

Issue Date : **14/05/2025**

Customer's Ref. : **PO. No. 0015413034**
Dated: 27/03/2025

STACK DETAILS

Sampling Location	: Thermo pack Stack-1	Sampling Procedure	: As per table
Sampling By	: Pollucon Laboratories Pvt. Ltd.	Protocol (purpose)	: Stack Monitoring
Date of Sampling	: 07/05/2025	Stack Height Ground Level	: 36 Meter
Date of Completion	: 14/05/2025	Fuel Used**	: Natural Gas
Time of Sampling in Hrs	: 15:00 TO 16:00	Cross Section Area (m ²)	: 0.1963
Stack Diameter**	: 0.50 Meter		
Lab ID	: APA/2505/01 [A-I]		

RESULT TABLE

SR. NO.	TEST PARAMETER	UNIT	RESULTS	GPCB LIMIT**	TEST/SAMPLING METHOD
1	Temperature of Flue Gas	°C	112	NS*	IS:11255 (Part-3)
2	Velocity of flue Gas	m/sec	6.51	NS*	IS:11255 (Part-3)
3	Particulate Matter	mg/Nm ³	Not Detected	120	IS 11255 (Part-1)
4	Sulfur Dioxide as SO ₂	ppm	5.65	80	IS 11255 (Part-2)
5	Oxides of Nitrogen as NO _x	ppm	25.46	40	IS 11255 (Part-7)
6	Volumetric Flow Rate of Gas	m ³ /sec	1.28	NS*	IS:11255 (Part-3)
7	Carbon Dioxide as CO ₂	mg/kg	57600	NS*	CPCB guidelines for source emission monitoring - Digital Gas Analyzers
8	Oxygen as O ₂	mg/kg	201586	NS*	
9	Carbon Monoxide as CO	mg/kg	Not Detected	NS*	

NS*: Not Specified, Detection Limit: Carbon Monoxide as CO: 0.001 mg/kg**Details provided by customer.
Results on 11 % O₂ Correction when Oxygen is Greater than 11 % and 12 % CO₂ Correction when CO₂ is less than 12 %


Ravi Jariwala

Sr. Environmental Scientist


Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.

End of Report

● Recognised Env. Lab under
Env. (Protection) Act-1986 (CPCB)

● Recognised Schedule II
Env. Auditor (GPCB)

● ZDHC Approved for
Wastewater Guidelines V2.2

● ISO 9001 / 14001 / 45001

"Pollucon House", Plot No. 5 & 6, Opp. Balaji Industrial Soc., Old Shantinath Silk Mill Lane, Navjivan Circle, Udhna Megdalla Road, Surat-395007, Gujarat, India.
Phone : 0261-2635750/51/75, Mo. 70166 05174, 70462 61750, WEB : www.polluconlab.com, E-mail : pollucon@gmail.com, quotation@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/TJ/20-ST

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED 2602, GIDC, INDUSTRIAL ESTATE, ANKLESHWAR - 393 002 TEL NO. (02646) 678 000	Test Report No. : PL/AP/25/05/0001 Issue Date : 17/05/2025 Customer's Ref. : PO. No. 0015413035 Dated: 27/03/2025
--	--

STACK DETAILS

Sampling Location	: DG SET - 1 GEN A 601 (Near Gate 1) (320 KVA)	Sampling Procedure	: As per table
Sampling By	: Pollucon Laboratories Pvt. Ltd.	Protocol (purpose)	: Stack Monitoring
Date of Sampling	: 07/05/2025	Stack Height/Ground Level	: 10 Meter
Date of Completion	: 12/05/2025	Fuel Used**	: HSD
Time of Sampling in Hrs	: 10:00 TO 11:00	Cross Section Area (m ²)	: 0.0314
Stack Diameter**	: 0.2 Meter		
Lab ID	: ASA/2505/14 [A-I]		

RESULT TABLE

SR. NO.	TEST PARAMETER	UNIT	RESULTS	GPCB LIMIT**	TEST/SAMPLING METHOD
1	Temperature of Flue Gas	°C	142	N5*	IS:11255 (Part-3)
2	Velocity of flue Gas	m/sec	6.56	N5*	IS:11255 (Part-3)
3	Particulate Matter	mg/Nm ³	18.4	120	IS 11255 (Part-1)
4	Sulfur Dioxide as SO ₂	ppm	9.2	50	IS 11255 (Part-2)
5	Oxides of Nitrogen as NO _x	ppm	26.9	40	IS 11255 (Part-7)
6	Volumetric Flow Rate of Gas	m ³ /sec	0.26	N5*	IS:11255 (Part-3)
7	Carbon Dioxide as CO ₂	mg/kg	75600	N5*	CPCB guidelines for source emission monitoring - Digital Gas Analyzers
8	Oxygen as O ₂	mg/kg	210749	N5*	
9	Carbon Monoxide as CO	mg/kg	Not Detected	N5*	

N5*: Not Specified, Detection Limit: Carbon Monoxide as CO: 0.001 mg/kg** Details provided by customer.
Results as 12 % O₂, Correction when Oxygen is Greater than 12 % and 12 % CO₂ Correction when CO₂ is less than 12 %

Ravi Jariwala

Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai

Dr. Arun Bajpai
Lab Manager(Q)

Note: This report is subject to terms & conditions of our Standard Agreement.

• An approved by MoEF, New Delhi under Section 17 of Environmental Protection Act-1986 • ISO 17025:2015 • ISO 9001:2015 • ISO 14001:2015 • ISO 45001:2018

"Pollucon House", Plot No.5/6, Opp.Balaji Industrial Society, Old Shanbhag Silk Mill Lane, Near Gayatri Farsan Mart,
Navjivan Circle, Udhana Magdalla Road, Surat-395007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2635775, 07616605174, WEB: www.polluconlab.com, E. mail: pollucon@gmail.com, info@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.0/20-ST

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED 2602, GIDC, INDUSTRIAL ESTATE, ANKLESHWAR - 393 002 TEL NO. (02646) 678 000	Test Report No. : PL/AP/25/05/0002 Issue Date : 17/05/2025 Customer's Ref. : PO. No. 0015413035 Dated: 27/03/2025
--	--

STACK DETAILS

Sampling Location	: DG SET - 3 GEN A 603 (Near Gate 1) (320 KVA)	Sampling Procedure	: As per table
Sampling By	: Pollucon Laboratories Pvt. Ltd.	Protocol (purpose)	: Stack Monitoring
Date of Sampling	: 07/05/2025	Stack Height (Ground level)	: 10 Meter
Date of Completion	: 12/05/2025	Fuel Used**	: HSD
Time of Sampling in Hrs	: 11:10 TO 12:10	Cross Section Area (m ²)	: 0.0314
Stack Diameter**	: 0.2 Meter		
Lab ID	: ASA/2505/15 [A-I]		

RESULT TABLE

SR. NO.	TEST PARAMETER	UNIT	RESULTS	GPCB LIMIT**	TEST/SAMPLING METHOD
1	Temperature of Flue Gas	°C	130	NS*	IS:11255 (Part-3)
2	Velocity of Flue Gas	m/sec	0.20	NS*	IS:11255 (Part-3)
3	Particulate Matter	mg/Nm ³	19.2	120	IS 11255 (Part-1)
4	Sulfur Dioxide as SO ₂	ppm	5.0	50	IS 11255 (Part-2)
5	Oxides of Nitrogen as NO _x	ppm	26.2	40	IS 11255 (Part-7)
6	Volumetric Flow Rate of Gas	m ³ /sec	0.25	NS*	IS:11255 (Part-3)
7	Carbon Dioxide as CO ₂	mg/kg	81000	NS*	GPCB guidelines for source emission monitoring - Digital Gas Analyzers
8	Oxygen as O ₂	mg/kg	214676	NS*	
9	Carbon Monoxide as CO	mg/kg	Not Detected	NS*	

NS*: Not Specified, Detection Limit: Carbon Monoxide as CO: 0.001 mg/kg**Details provided by customer.

Results at 15 % O₂, Correction when Oxygen is Greater than 15 % and 12 % CO₂, Correction when CO₂ is less than 12 %

Ravi Jariwala
Sr. Environmental Scientist

Dr. ArunBajpai
Lab Manager(Q)

ISO 9001:2015 Certified by Bureau Veritas Certification Pvt. Ltd.

• Recognized by MoEF, New Delhi Under • GPCB approved • ISO 14001:2015 • ISO 45001:2018 • ISO 9001:2015
Annex 12 of Environmental Protection Act 1986 • Accredited by NABL

"Pollucon House", Plot No.54, Opp.Balaji Industrial Society, Old Shantinagar Silk Mill Lane, Near Gajin Farsan Met,
Navjivan Circle,Adarva, Mugda La Road, Surat-395007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2625775, 0761-605174, WEB: www.polluconlab.com, E. mail: pollucon@gmail.com, info@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/20-ST

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED 2602, GIDC, INDUSTRIAL ESTATE, ANKLESHWAR - 393 002 TEL NO. (02646) 676 000	Test Report No. : PL/AP/25/05/0003 Issue Date : 17/05/2025 Customer's Ref. : PO. No. 0015413035 Dated: 27/03/2025
--	--

STACK DETAILS

Sampling Location :	DG SET- 4 GEN A-610 (Near Gate 1) (500 KVA)	Sampling Procedure :	As per table
Sampling By :	Pollucon Laboratories Pvt. Ltd.	Protocol (purpose) :	Stack Monitoring
Date of Sampling :	07/05/2025	Stack Height Ground Level :	10 Meter
Date of Completion :	12/05/2025	Fuel Used** :	HSD
Time of Sampling in Hrs :	12:20 TO 13:20	Cross Section Area (m ²) :	0.0314
Stack Diameter** :	0.2 Meter		
Lab ID :	ASA/2505/16 [A-I]		

RESULT TABLE

SR. NO.	TEST PARAMETER	UNIT	RESULTS	GPCB LIMIT**	TEST/SAMPLING METHOD
1	Temperature of Flue Gas	°C	127	NS*	IS:11255 (Part-3)
2	Velocity of Flue Gas	m/sec	7.68	NS*	IS:11255 (Part-3)
3	Particulate Matter	mg/Nm ³	24.2	120	IS 11255 (Part-1)
4	Sulfur Dioxide as SO ₂	ppm	6.4	80	IS 11255 (Part-2)
5	Oxides of Nitrogen as NO _x	ppm	33.2	40	IS 11255 (Part-7)
6	Volumetric Flow Rate of Gas	m ³ /sec	0.26	NS*	IS:11255 (Part-3)
7	Carbon Dioxide as CO ₂	mg/kg	73000	NS*	CPCB guidelines for source emission monitoring - Digital Gas Analyzers
8	Oxygen as O ₂	mg/kg	215965	NS*	
9	Carbon Monoxide as CO	mg/kg	Not Detected	NS*	

NS*: Not Specified, Detection Limit: Carbon Monoxide as CO: 5000 mg/kg**Details provided by customer.
Results < 1% CO₂ Correction when Oxygen is Greater than 11% and 12% CO₂ Correction when CO₂ is less than 12 %

Ravi Jariwala

Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai

Dr. Arun Bajpai
Lab Manager(Q)

Notes: This report is valid for the sample conditions mentioned herein.

● Recognized by MoEF, New Delhi under Sec. 12 of Environmental Protection Act, 1986. ● ISO 15189:2013 ● ISO 17025:2017 ● ISO 9001:2015

"Pollucon House", Plot No.56, Opp. Balaji Industrial Society, Old Shanabnath Silk Mill Lane, Near Gaytri Parkson Mart,
Navjivan Circle, Udhana Magdalla Road, Surat-395007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2635775, 07016605174, WEB: www.polluconlabs.com, E-mail: pollucon@gmail.com, info@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/20-ST

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED 2602, GIDC, INDUSTRIAL ESTATE, ANKLESHWAR - 393 002 TEL NO. (02646) 678 000	Test Report No. : PL/AP/25/05/0004 Issue Date : 17/05/2025 Customer's Ref. : PO. No. 0015413035 Dated: 27/03/2025
--	--

STACK DETAILS

Sampling Location	: DG SET - 5 GEN A 609 (Near Gate 1) (1250 KVA)	Sampling Procedure	: As per table
Sampling By	: Pollucon Laboratories Pvt. Ltd.	Protocol (purpose)	: Stack Monitoring
Date of Sampling	: 07/05/2025	Stack Height Ground level	: 30 Meter
Date of Completion	: 12/05/2025	Fuel Used**	: HSD
Time of Sampling in Hrs	: 13:30 TO 14:30	Cross Section Area (m ²)	: 0.0961
Stack Diameter**	: 0.35 Meter		
Lab ID	: ASA/2505/17 [A-I]		

RESULT TABLE

SR. NO.	TEST PARAMETER	UNIT	RESULTS	GPCB LIMIT**	TEST/SAMPLING METHOD
1	Temperature of Flue Gas	°C	130	NS*	IS:11255 (Part-3)
2	Velocity of Flue Gas	m/sec	0.26	NS*	IS:11255 (Part-3)
3	Particulate Matter	mg/Nm ³	16.4	120	IS 11255 (Part-1)
4	Sulfur Dioxide as SO ₂	ppm	5.9	80	IS 11255 (Part-2)
5	Oxides of Nitrogen as NO _x	ppm	21.3	40	IS 11255 (Part-7)
6	Volumetric Flow Rate of Gas	m ³ /sec	0.78	NS*	IS:11255 (Part-3)
7	Carbon Dioxide as CO ₂	mg/kg	81000	NS*	CPCB guidelines for source emission monitoring - Digital Gas Analyzers
8	Oxygen as O ₂	mg/kg	213367	NS*	
9	Carbon Monoxide as CO	mg/kg	Not Detected	NS*	

NS*: Not Specified, Detection Limit: Carbon Monoxide as CO: 0.001 mg/kg**Details provided by customer.

Results as % CO₂, Correction when Oxygen is Greater than 12 % and 12 % CO₂, Correction when CO₂ is less than 12 %

Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai
Lab Manager(Q)

Note: Pollucon Laboratories Pvt. Ltd. is an ISO 9001:2015 certified company.

• Recognized by MoEF, New Delhi Under Section 12 of Environmental Protection Act-1986 • GPCB approved • ISO 10012:2018 • ISO 14001:2015 • ISO 9001:2015

"Pollucon House", Plot No.5/6, Opp.Bajaj Industrial Society, Old Shantiseth Silk Mill Lane, Near Gopini Fashion Mart,
Navjivan Chole, (Jaliscoo Marg) 14 Road, Surat-395007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2635775, 07916605774, WEB: www.polluconlab.com, E-mail: pollucon@gmail.com, info@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/37-ST

Page: 1 of 1

Customer's Name and Address :

M/s. ASIAN PAINTS LIMITED 2602, GIDC, INDUSTRIAL ESTATE, ANKLESHWAR - 393 002 TEL NO. (02646) 678 000	Test Report No. : PL/AP/25/05/0005 Issue Date : 17/05/2025 Customer's Ref. : PO. No. 0015413035 Dated: 27/03/2025
--	--

STACK DETAILS

Date of Sampling : 07/05/2025	Location of Sampling : Incinerator stack
Sample Receipt Date : 08/05/2025	Sampling by : Pollucon Laboratories Pvt. Ltd.
Date of Starting of Test : 08/05/2025	Lab. ID/Sub-Contract : APA/2505/18 [A-J]
Date of Completion : 12/05/2025	

Velocity m/sec : 6.42	Flue gas Temperature °C : 78	Moisture % : 8.24
	Flue gas composition : O ₂ -9.6%, CO ₂ -8.6%, N ₂ -81.8%	

RESULT TABLE

Sr. NO.	PARAMETER	UNIT	RESULT	LIMIT*	TEST/SAMPLING METHOD
1	Particulates Matter	mg/Nm ³	29.7	40 Max.	IS 11255 (Part-1)
2	HCl	mg/Nm ³	14.6	40 Max.	USEPA Method 26 A
3	SO ₂	mg/Nm ³	54.2	160 Max.	IS 11255 (Part-2)
4	Total Organic Carbon (TOC)	mg/Nm ³	Not Detected	16 Max.	SOP/INS/ST/07
5	NOx (by PDA method)	mg/Nm ³	109	320 Max.	IS 11255 (Part-7)
6	Sb + As + Pb + Cr + Cu + Mn + Ni + V (and their cpds.)	mg/Nm ³	0.26	0.4 Max.	SOP Stack: HM-5 (Ref: US EPA Method 29:1996)
7	Hg (and its cpds.)	mg/Nm ³	Not Detected	0.04 max.	
8	Cd+Th (and its cpds.)	mg/Nm ³	Not Detected	0.04 max.	
9	Carbon Monoxide	mg/Nm ³	16.1	60 Max.	CPCB Guidelines for Source Emission Monitoring / Digital Gas Analyzers
10	HF	mg/Nm ³	1.06	3.2 Max.	USEPA Method 26 A
11	Hydro Carbon as HC	mg/Nm ³	Not Detected	---	Digital GAS Analyzer/GC
12	Volumetric Flow rate	Nm ³ /Hr	5130	---	IS-11255 (Part-3)

*Above Result are corrected on 11% O₂ if Required

Unfractionated Total Organic Carbon (TOC) 500 mg/Nm³, Hg (and its cpds.) 0.12 mg/Nm³, Cd+Th (and its cpds.) 0.025 mg/Nm³

Ravi Jariwala

Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai

Dr. Arun Bajpai
Lab Manager(Q)

As per "Approved Laboratories & Facilities" notified by Govt.

★ Recognized by MoEF, New Delhi Order: 12 of Environment and Forests (G.O. No. 12011/2004) ★ CPCB approved ★ ISO 15001:2005 ★ ISO 14001:2004 ★ ISO 9001:2008 ★ ISO 17025:2005

"Pollucon House", Plot No.5%, Opp.Bela Industrial Society, Old Shantinath Silk Mill Lane, Near Gayatri Farsan Mart,
Navjivan Circle, Vidhana Marg, Gandhinagar, Surat-393007, Gujarat, India.

Phone : 0261-2635750, 0261-2635751, 0261-2635775, 07916605174, WEB: www.polluconlab.com, E. mail: pollucon@gmail.com, info@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure H

VOC analysis report



TEST CERTIFICATE

QM/7.6/20-IX

Page: 1 of 1

Customer's Name and Address :

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : PL/AP/25/04/0019
Issue Date : 02/05/2025
Customer's Ref. : PO. No. 0015413035
Dated: 27/03/2025

VOC RESULT

Date of Sampling : As per table Test parameters : VOC
Sampling Team Member : Pollucon Laboratories Pvt. Ltd. Test Method : VOC Meter
Description of Instrument Used : VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK

SR. NO.	LOCATION	VOC in ppm			
		04/04/2025	11/04/2025	18/04/2025	25/04/2025
1	IPB Ground Floor	5.6	5.2	4.5	4.7
2	IPB 1 st Floor	2.2	2.6	2.1	2.8
3	IPB 2 nd Floor	9.6	9.4	9.1	8.6
4	EIRS 2 nd Floor	2.6	2.5	1.9	2.2
5	EIRS 1 st Floor	0.8	0.7	0.9	1.3
6	EIRS 3 rd Floor	4.2	4.3	4.2	4.5
7	SFB Laboratory	8.6	8.2	7.2	6.8
8	SFB 2 nd Floor	3.7	3.2	4.6	4.2


H. T. Shah
Lab. Manager


Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

● Prepared by: N. S. B. B. B. B.
Lab. Manager (Q) 14201-45001

● Checked by: N. S. B. B. B. B.
Lab. Manager (Q) 14201-45001

● Approved by: N. S. B. B. B. B.
Lab. Manager (Q) 14201-45001

● Lab. No. 14201-45001

"Pollucon House", Plot No. 5 & 6, Opp. Bafal Industrial Soc., Old Shantinagar 5th Mile Lane, Navjivan Circle, UnNava Magdala Road, Surat-393007, Gujarat, India.
Phone: 0261-2632700/01/02. Ms. 70188 05174, 70402 87750, WEB: www.polluconlab.com, E-mail: pollucon@gmail.com, queries@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



TEST CERTIFICATE

Q5/7 370 EX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED PLOT NO.:2702, GIDC, ANKLESHWAR - 393 002.	Test Report No. : PL/APA/25/04/0002 Issue Date : 09/04/2025 Customer's Ref. : PO. No. 0015413014 Dated: 27/03/2025
---	---

VOC RESULT

Date of Sampling	: As per table	Test parameters	: VOC
Sampling Team Member	: Pollucon Laboratories Pvt. Ltd.	Test Method	: VOC Meter
Description of Instrument Used	: VOC Meter, Model: Photocheck TIGER, Make: IDN Science, UK		

SR. NO.	LOCATION	VOC in ppm
		02/04/2025
SPB:		
1	SPB Ground Floor (Packing Floor)	5.1
2	SPB Mezzanine Floor	7.8
3	SPB First Floor (Processing Floor)	3.4
4	SPB First Floor (SPB PQC Lab)	1.1
5	SPB Second Floor	6.3
6	RB Ground Floor (Packing Floor)	2.7
7	RB Mezzanine Floor (Filtration Floor)	5.6
8	RB First Floor (BL/Processing Floor)	4.5
9	RB Second Floor (REA Floor)	5.3


H. T. Shah
Lab. Manager


Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf
End of Report

● Recognized Lab. Lab number
Lab. (Pollution) No: 1940 (CPCB)

● Recognized Lab. Lab No.
Lab. (Pollution) No: 1940 (CPCB)

● Recognized Lab. Lab No.
Lab. (Pollution) No: 1940 (CPCB)

● Recognized Lab. Lab No.
Lab. (Pollution) No: 1940 (CPCB)

"Pollucon House", Plot No. 3 & 4, Opp. Bhatia Industrial Soc., Old Bham Road, SPC, MIDC, Ankleshwar, District: Bharuch, Gujarat, India
Phone: 0261-2651750/0261-2651751 Fax: 0261-2651752 Website: www.polluconlabs.com Email: info@polluconlabs.com, sales@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/25/20-BX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 676 000

Test Report No. : PL/AP/25/05/0018
Issuance Date : 04/06/2025
Customer's Ref. : PG. No. 0015413035
Dated: 27/03/2025

VOC RESULT

Date of Sampling : As per table Test parameters : VOC
Sampling Team Member : Pollucon Laboratories Pvt. Ltd. Test Method : VOC Meter
Description of Instrument Used : VOC Meter, Model: Photocheck T360R, Make: IDN Science, UK

SR. NO.	LOCATION	VOC in ppm			
		02/05/2025	07/05/2025	23/05/2025	30/05/2025
1	IPB Ground Floor	5.1	4.8	4.3	3.9
2	IPB 1 st Floor	1.5	1.9	2.3	1.7
3	IPB 2 nd Floor	7.9	8.3	8.9	7.5
4	ETRS 2 nd Floor	1.9	2.1	1.5	1.6
5	ETRS 1 st Floor	0.6	0.5	0.8	0.9
6	ETRS 3 rd Floor	3.6	3.5	3.4	3.5
7	SPB Laboratory	6.5	6.2	6.9	7.1
8	SPB 7 th Floor	1.5	3.1	3.9	1.6

H. T. Shah
Lab. Manager

Dr. Arun Bhatnagar
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned elsewhere.

End of Report

• Recognized for Lab under
Env. Protection Act-1986 (EPA)

• Recognized Schedule II
Env. Protection Act-1986

• Lab is approved for
Wastewater Guidelines V.1.1

• ISO 9001 : 2008 : 45001

"Pollucon House", Plot No. 3 & 4, Opp. Shreeji Industrial Soc., Old Shantivadi St., Mill Lane, Navjeevan Circle, Vidhaya Nagar, Gandhinagar, Ahmedabad, Gujarat, India.
Phone : 9211-26073/30730, 79402 61730, 61730, 61730 : www.polluconlabs.com, Email : pollucon@pollucon.com, quality@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



TEST CERTIFICATE

QF/7.8/23 EX

Customer's Name and Address

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED PLOT NO.:2702, GIDC, ANKLESHWAR - 393 002.	Test Report No. : PL/APA/25/05/0003 Issue Date : 14/05/2025 Customer's Ref. : PO. No. 0015413034 Dated: 27/03/2025
--	--

VOC RESULT

Date of Sampling : As per table	Test parameters : VOC
Sampling Team Member : Pollucon Laboratories Pvt. Ltd.	Test Method : VOC Meter
Description of Instrument Used : VOC Meter, Model: Photocheck T1000, Make: 3M Science, UK	

SR. NO.	LOCATION	VOC in ppm
		02/05/2025
SPB		
1	SPB Ground Floor (Packing Floor)	5.8
2	SPB Mezzanine Floor	7.1
3	SPB First Floor (Processing Floor)	3.9
4	SPB First Floor (SPB RQC Lab)	3.7
5	SPB Second Floor	6.1
6	RB Ground Floor (Packing Floor)	2.4
7	RB Mezzanine Floor (Filtration Floor)	4.6
8	RB First Floor (RI/Processing Floor)	3.3
9	RB Second Floor (REA ROOM)	5.9
10	RB Second Floor (RB Lab)	3.2
11	RB Third Floor (Hopper Floor)	3.8

H. T. Shah
Lab. Manager

Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

• Recognized Pb. Lab under
Law: (Pollution) Act-1986 (PCRA)
 • Recognized Schedule II
Env. Auditor (GVA)
 • ISO/IEC 17025:2017, 43001
 • ISO 9001:2015, 43001

"Pollucon (India)", Plot No. 9 & 6, Opp. Balaji Industrial Bldg., Old Shastri Nagar, Old Mithi Lane, Nanjan Circle, Ulhas Nagar, Gandhinagar, Surat-392007, Gujarat, India.
Phone : 0261-2637330/3373, Mo. 70160 88374, 70462 67750, Web : www.polluconindia.com, E-mail : pollucon@gmail.com, gaptol@polluconindia.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



TEST CERTIFICATE

QF/7 @20-EX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : **PL/AP/25/06/0019**
Issue Date : **03/07/2025**
Customer's Ref. : **PO. No. 0015413035**
Dated: **27/03/2025**

VOC RESULT

Date of Sampling : **As per table** Test parameters : **VOC**
Sampling Team Member : **Pollucon Laboratories Pvt. Ltd.** Test Method : **VOC Meter**
Description of Instrument Used : **VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK**

SRL NO.	LOCATION	VOC in ppb			
		04/06/2025	09/06/2025	17/06/2025	24/06/2025
1	SPB Ground Floor	4.5	6.3	7.6	7.1
2	SPB 1 st Floor	1.8	1.6	2.1	1.5
3	SPB 2 nd Floor	8.2	8.9	9.6	7.2
4	EIRS 2 nd Floor	1.6	1.9	1.2	1.5
5	EIRS 1 st Floor	0.9	0.7	0.8	0.6
6	EIRS 3 rd Floor	2.6	2.2	2.1	1.8
7	SPB Laboratory	7.3	7.9	6.4	5.8
8	SPB 2 nd Floor	3.2	2.5	2.9	3.8


H. T. Shah
Lab. Manager


Dr. Arun Rajpal
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf,
End of Report

- Recognized & Co. Lab under Env. (Protection) Act-1986 (EPA)
- Recognized Schedule 19 Env. Auditor (EPA)
- ISO 9001:2015 Certified Water Meter Calibration V2.3
- ISO 9001:2015 & ISO 14001:2015

"Pollucon Meter", Plot No. 9 B B, Opp. Balaji Industries, Sec. - Old Bunder, BFA Hill Lane, Nakhuda Circle, Ultra Mega City Road, Barai-281007, Gujarat, India.
Phone: 0261-264073/0173, Mo. 92160 89574, 75482 61735, Web: www.polluconlab.com, E-mail: pollucon@pollucon.com, quatshah@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



TEST CERTIFICATE

QF/7 & 20-DX

Customer's Name and Address :

Page: 1 of 1

**M/S. ASIAN PAINTS LIMITED
PLOT NO.:2702, GIDC,
ANKLESHWAR - 393 002.**

Test Report No. : **PL/APA/25/06/0003**
Issue Date : **20/06/2025**
Customer's Ref. : **PO. No. 0025413034**
Dated: 27/03/2025

VOC RESULT

Date of Sampling : **As per table** Test parameters : **VOC**
Sampling Team Member : **Pollucon Laboratories Pvt. Ltd.** Test Method : **VOC Meter**
Description of Instrument Used : **VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK**

SR. NO.	LOCATION	VOC in ppm 13/06/2025
/SPB		
1	SPB Ground Floor (Packing Floor)	4.3
2	SPB Mezzanine Floor	7.6
3	SPB First Floor (Processing Floor)	4.5
4	SPB First Floor (SPB PQC Lab)	3.3
5	SPB Second Floor	5.8
6	RB Ground Floor (Packing Floor)	3.5
7	RB Mezzanine Floor (Filtration floor)	3.7
8	RB First Floor (BI/Processing Floor)	3.3
9	RB Second Floor (REA Floor)	5.6
10	RB Second Floor (RB Lab)	2.7
11	RB Third Floor (Hopper Floor)	2.9

H. T. Shah
Lab. Manager

Dr. Anurag Rajpal
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

• Recognized Env. Lab under ISO 14001:2015 (PCB) • Recognized Schedule II Env. Analyte (17°C) • ISO 17025:2017 Approved by NABL (Gujarat) • NABL 5301 : 1101 : 12003

"Pollucon House", Plot No. 5 & 6, Opp. Bata, Industrial Area, Old Airport Road, B-10/11 Lane, Nanthan Circle, Udhna-Magdala Road, Surat-392007, Gujarat, India.
Phone : 0261-2623750/575 Fax : 2619553143, 262011231, Web : www.polluconlabs.com, Email : pollucon@gmail.com, qa@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF778/20-EX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 676 000

Test Report No. : **PL/AP/25/07/0019**
Issue Date : **02/08/2025**
Customer's Ref. : **PO, No. 0015413035**
Dated: **27/03/2025**

VOC RESULT

Date of Sampling : **As per table** Test parameters : **VOC**
Sampling Team Member : **Pollucon Laboratories Pvt. Ltd.** Test Method : **VOC Meter**
Description of Instrument Used : **VOC Meter, Model: Photochem TIGER, Make: ION Science, UK**

SR. NO.	LOCATION	VOC in ppm			
		02/07/2025	09/07/2025	14/07/2025	22/07/2025
1	[PB Ground Floor	4.7	5.6	6.8	5.0
2	[PB 1 st Floor	2.3	2.4	1.5	1.8
3	[PB 2 nd Floor	8.5	8.9	8.2	7.6
4	EIRS 2 nd Floor	1.8	1.6	1.1	1.4
5	EIRS 1 st Floor	0.6	0.5	0.6	0.9
6	EIRS 1 st Floor	2.5	2.1	2.3	1.5
7	SPB Laboratory	7.1	7.6	7.5	7.9
8	SPB 2 nd Floor	1.5	1.8	1.9	3.2


H. T. Shah
Lab. Manager


Dr. Arun Rajpal
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

► Recognized Env. Lab under
Pmk. (Pollution) Act-1986 (CPCB)

► Recognized as Lab. for
EPA & BIS/ISIRI (CPCB)

► ISO 9001:2015 Approved for
Waste Water Laboratories (22)

► ISO 9001:2015 & ISO 14001:2015

"Pollucon House", Plot No. 1 & 2, Opp. Bala Industrial Soc., Old Bhambhai Bldg. NE Corner, Chhatra Margdale Road, Surat-395007, Gujarat, India.
Phone : 0221-2031786/1978, No. 70180 05474, 70402 61236, WEB : www.polluconlab.com, E-mail : pollucon@gmail.com, queries@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QE/7.8/20-FX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED PLOT NO.:2702, GIDC, ANKLESHWAR - 393 002.	Test Report No. :	PL/APA/25/07/0004A
	Issue Date :	28/07/2025
	Customer's Ref :	PO Number: 0015433034, PO Date: 27.03.2025

VOC RESULT

Date of Sampling :	As per Table	Test Parameters :	VOC
Sampling Team Member :	Pollucon Laboratories Pvt. Ltd.	Test Method :	VOC Meter
Description of Instrument Used :	VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK		

SRL NO.	LOCATION**	VOC in ppm			
		02/07/2025	09/07/2025	14/07/2025	22/07/2025
1	SPB Ground Floor (Packing Floor)	5.4	3.6	4.3	4.8
2	SPB Mezzanine Floor	5.9	7.4	6.5	7.1
3	SPB First Floor (Processing Floor)	3.2	3.7	4.2	4.8
4	SPB First Floor (SPB PQC Lab)	3.9	3.2	2.7	2.5
5	SPB Second Floor	6.8	6.3	5.1	6.5
6	RB Ground Floor (Packing Floor)	2.2	2.5	2.9	1.8
7	RB Mezzanine Floor (Filtration Floor)	4.9	3.5	3.9	4.2
8	RB First Floor (BL/Processing Floor)	3.7	3.2	3.9	4.8
9	RB Second Floor (REA Floor)	6.8	6.2	6.2	5.9
10	RB Second Floor (RB Lab)	3.5	3.3	3.1	2.8
11	RB Third Floor (Hopper Floor)	4.2	4.8	4.5	5.1

** : Data provided by customer

H. T. Shah
Lab. Manager

Dr. Arun Rajpal
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

- Recognized Env. Lab under
Env. (Protection) Act, 1986 (CPCB)
- Recognized Lab under
Env. Auditor (CPCB)
- ISO 9001:2015
Management System V2.1
- ISO 9001:2015 / 43001

"Pollucon Labs", Plot No. 5 & 6, Opp. Bharuch Industrial Zone, Old Shardaresh, 393101, Ankleshwar, Gujarat, India.
Phone : 0261-2555730/731, Mo. 98160 20174, 98462 61799, WhatsApp : 98160 20174, Email : pollucon@gmail.com, q-coumbo@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF17.8/20-EX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : PL/AP/25/08/0015

Issue Date : 05/09/2025

Customer's Ref. : PG. No. 0015419035

Dated: 27/03/2025

VOC RESULT

Date of Sampling : As per table Test parameters : VOC
Sampling Team Member : Pollucon Laboratories Pvt. Ltd. Test Method : VOC Meter
Description of Instrument Used : VOC Meter, Model: Photocheck TIGER, Make: SON Science, UK

SR. NO.	LOCATION	VOC in ppm			
		02/08/2025	12/08/2025	19/08/2025	27/08/2025
1	IPB Ground Floor	5.0	6.7	4.6	5.2
2	IPB 1 st Floor	2.4	2.8	2.8	2.7
3	IPB 2 nd Floor	8.6	7.9	7.8	8.4
4	EIRS 2 nd Floor	1.6	2.8	1.9	2.6
5	EIRS 1 st Floor	0.9	0.7	0.5	0.6
6	EIRS 3 rd Floor	2.2	2.5	2.1	2.5
7	SPB Laboratory	5.6	5.1	5.6	5.7
8	S-U 2 nd Floor	5.0	5.8	3.3	2.8


H. T. Shah
Lab. Manager


Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.
End of Report

► ISO 9001:2015, ISO 14001:2015, ISO 45001:2018
Eco- (Protection) Act-1986 (CPCB)

► Recognized Schedule II
Env. Auditor (SPLB)

► ZDHC Approved for
Wastewater Guidelines 2.1

► ISO 9001 / 14001 / 45001

"Pollucon House", Plot No. S.S. 6, Opp. Bafra Industrial Soc., Old Shantinath Mills Mill Lane, Rajpuran Circle, Vidya Nagar Road, Surat-393007, Gujarat, INDIA.
Phone : 0261-2631760/53076, Fax: 70166 95174, 70482 61736, 93780 www.polluconlabs.com, E-mail: pollucon@gmail.com, qac@polluconlabs.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/23-PK

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED PLOT NO.:2702, GIDC, ANKLESHWAR - 393 002.	Test Report No. : PL/APA/25/08/0009 Issue Date : 01/09/2025 Customer's Ref. : PO Number: 8015413036, PO Date: 27.03.2025
---	---

VOC RESULT

Date of Sampling :	As per table	Test parameters :	VOC
Sampling Team Member :	Pollucon Laboratories Pvt. Ltd.	Test Method :	VOC Meter
Description of Instrument Used :	VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK		

SR. NO.	LOCATION**	VOC in ppm			
		02/08/2025	12/08/2025	19/08/2025	27/08/2025
1	SPB Ground Floor (Packing Floor)	5.8	4.7	5.3	5.2
2	SPB Mezzanine Floor	4.1	4.8	3.3	2.8
3	SPB First Floor (Processing Floor)	4.6	3.9	5.5	5.8
4	SPB First Floor (SPB PQC Lab)	3.6	3.5	2.6	2.8
5	SPB Second Floor	3.9	4.5	5.3	3.5
6	RB Ground Floor (Packing Floor)	2.9	1.8	1.8	2.2
7	RB Mezzanine Floor (Packing Floor)	6.2	5.9	3.2	4.8
8	RB First Floor (BL/Processing Floor)	6.5	4.5	6.4	3.7
9	RB Second Floor (R&A Floor)	7.1	6.8	4	2.9
10	RB Second Floor (RB Lab)	3.9	7.8	5.8	7.6
11	RB Third Floor (Hopper Floor)	3.3	5.8	3.4	5.4

** Data is provided by customer.

H. T. Shah
Lab. Manager

Dr. Ansh Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.

End of Report

• Recognized Lab. Lab under
Env. (Protection) Act-1986 (CPCB)

• Recognized Laboratory II
Lab. Authority (CPCB)

• ISO 15189 Approved for
Waterborne Coatings VTT

• ISO 9001 : 2015 : 45001

"Pollucon House" Plot No. 3 A 1, Opp. Shree Industrial Zone, Old Bhadresh Life Hill Lane, Nodhan Circle, Vidya Nagar Road, Bara-360037, Gujarat, India.
Phone : 0661 200220/21/22, M: 70956 03174, 70452 01750, WEB : www.polluconlab.com, Email : pollucon@gmail.com, quant@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.0/23-EX

Page: 1 of 1

Customer's Name and Address :

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TFL NO. (02646) 676 308

Test Report No. : PL/AP/25/09/0022

Issue Date : 07/10/2025


Customer's Ref. : PG. No. 0015413035
Dated: 27/03/2025

VOC RESULT

Date of Sampling :	As per table	Test parameters :	VOC
Sampling Team Member :	Pollucon Laboratories Pvt. Ltd.	Test Method :	VOC Meter
Description of Instrument Used :	VOC Meter, Model: Photacheck TIGER, Make: 10N Science, UK		

SR. NO.	LOCATION	VOC in ppm			
		02/09/2025	09/09/2025	19/09/2025	27/09/2025
1	IPB Ground Floor	4.7	4.9	5.8	5.1
2	IPB 1 st Floor	3.8	3.1	3.1	3.5
3	IPB 2 nd Floor	6.9	6.5	5.8	5.9


H. T. Shah
Lab. Manager


Dr. Arun Bajpai
Lab Manager (Q)

Note: This result is subject to L1 & S conditions mentioned overleaf.
End of Report

* Recognized & Eval. Lab under
Env. Protection Act 1986 (CPCB)

* Recognized & Evaluated II
Env. Auditor (CPCB)

* ZUHC Approved for
Water & Air Quality (pH 22)

* ISO 9001 : 2015 : 45001

"Pollucon House", Plot No. 3 A E, Opp. Rajaji Industrial Rec., Old Sagar near SRI MHI Janta, Mangem Circle, Uttara Margdale Road, Surat-394007, Gujarat, India.
Phone : 0264-263760/5775. Fax: 32966 8974, 76462 81136. MOB : www.polluconlab.com. E-mail : pollucon@gmail.com, quality@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE

QF/7.8/20-EX

Customer's Name and Address :

Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
PLOT NO.:2702, GIDC,
ANKLESHWAR – 393 002.

Test Report No. : **PL/APA/25/09/0005**
Issue Date : **07/10/2025**
Customer's Ref. : **PO Number: 0015413034,**
PO Date: 27.03.2025

VOC RESULT

Date of Sampling : **As per table** Test parameters : **VOC**
Sampling Team Member : **Pollucon Laboratories Pvt. Ltd.** Test Method : **VOC Meter**
Description of Instrument Used : **VOC Meter, Model: Photocheck TIGER, Make: ION Science, UK**

SR. NO.	LOCATION**	VOC in ppm			
		02/09/2025	09/09/2025	19/09/2025	27/09/2025
1	EBG	5.1	4.8	8.2	6.5
2	RBG	2.5	4.3	2.7	4.3
3	WBG	4.5	4.1	8.8	6.6
4	SBG	4.6	3.7	4.5	8.3
5	EB- Ground Floor Filtration & Packing	7.3	6.9	5.7	8.6
6	EB - First Floor Reactor	7.1	3.1	8.7	7.5
7	EB- Second Floor -Pet	5.1	3.5	6.8	8.4
8	EB- Third Floor Batching Station	5.8	5.4	5.2	2.7
9	RB - Ground Floor Filtration & Packing	6.7	5.5	3.6	6.4
10	RB- First Floor Blender	2.8	4.9	7.3	7.1
11	RB- Second Floor Reactor	7.5	8.1	4.1	7.7
12	RB - Third Floor Hopper Charging & BT	3.1	6.2	7.8	2.9
13	SB- Ground Floor Packing	4.9	4.6	6.6	2.5
14	SB- Mezzanine Floor	5.2	3.3	5.1	6.1
15	SB- First Floor Processing	5.1	4.9	4.4	5.9
16	SB- Second Floor Pre Processing	5.9	4.3	5.8	7.6
17	SB- Third Floor Batching Station	8.2	3.0	3.8	2.7
18	WB- Ground Floor Packing	7.4	3.2	8.8	3.4
19	WB- Mezzanine Floor Hopper	4.1	7.6	6.3	6.1
20	WB- First Floor Processing	4.2	6.6	3.5	6.8
21	WB- Second Floor Pre Processing	3.7	3.4	3.5	7.3
22	WB- Third Floor Batching Station	8.5	6.3	8.7	7.2
23	SB PQC Lab	7.1	7.0	4.7	6.4
24	WB PQC Lab	2.7	8.1	3.3	4.8
25	EB PQC Lab	5.7	6.5	8.1	4.2
26	RB PQC Lab	6.2	6.8	3.5	8.5

** : Details provided by customer.


H. T. Shah
Lab. Manager


Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.

End of Report

● Recognised Env. Lab under
Env. (Protection) Act-1986 (CPCB)

● Recognised Schedule II
Env. Auditor (GPCB)

● ZDHC Approved for
Wastewater Guidelines V2.2

● ISO 9001 / 14001 / 45001


"Pollucon House", Plot No. 5 & 6, Opp. Bataji Industrial Soc., Old Shantinath Silk Mill Lane, Navjivan Circle, Udhna Magdalla Road, Surat-395007, Gujarat, India.
Phone : 0261-2635750/5175, Mo. 70168 05174, 70482 61750, WEB : www.polluconlab.com, E-mail : pollucon@gmail.com, quotation@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure I

Ambient Air Quality Monitoring report



POLLUCON LABORATORIES PVT. LTD.

TEST REPORT FOR AMBIENT AIR QUALITY MONITORING

QR/7.6/20 AQ

Page: 1 of 1

Customer's Name and Address

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : PL/AP/25/04/0020

Issue Date : 02/05/2025

Customer's Ref. : PO. No. 0015413035

Dated: 27/03/2025

Location of Sampling : New Ware House

Date of Sampling : As per table

Sampling By : Pollucon Laboratories Pvt. Ltd.

Sampling Duration : 24 Hrs.

Sampling Procedure : As per table

Protocol (Purpose) : Ambient Air Quality Monitoring

Lab ID : As per table

RESULT TABLE

TEST PARAMETER	UNIT	DATE OF SAMPLING									LIMIT*	TEST/ SAMPLING METHOD
		01/04 /2025	04/04 /2025	08/04 /2025	11/04 /2025	15/04 /2025	18/04 /2025	22/04 /2025	25/04 /2025	29/04 /2025		
Lab ID ASA/2504(A-M)		01	04	08	11	15	18	22	25	29		
Respirable Particulate Matter (PM ₁₀)	µg/m ³	19.44	69.78	51.72	75.05	84.31	90.34	80.63	92.52	83.76	100	IS 5182 (Part-2)
Particulate Matter (PM _{2.5})	µg/m ³	44.12	35.33	53.53	37.70	45.24	52.41	46.22	50.36	47.53	80	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Sulphur Dioxide as SO ₂	µg/m ³	21.43	17.64	22.60	26.37	24.65	30.96	15.38	25.46	19.63	80	IS 5182 (Part-2)
Nitrogen Dioxide as NO ₂	µg/m ³	26.56	31.43	30.46	42.44	39.37	34.44	25.83	37.65	31.45	90	IS 5182 (Part-6)
Ozone (O ₃)	µg/m ³	29.64	21.64	31.68	23.67	25.45	28.39	24.34	30.66	27.67	180	IS 5182 (Part-V)
Carbon Monoxide as CO	mg/m ³	0.94	0.97	0.71	0.93	0.86	0.98	0.81	0.95	0.87	04	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Ammonia as NH ₃	µg/m ³	25.92	32.31	19.18	34.46	30.00	26.60	21.04	24.56	29.48	400	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Benzene as C ₆ H ₆	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	05	IS 5182 (Part-12)
Benzene (a) Pyrene (BaP)- Particulate Phase Only	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Arsenic as As	ng/m ³	ND*	ND*	2.56	ND*	ND*	2.36	ND*	2.43	ND*	09	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Nickel as Ni	ng/m ³	ND*	ND*	10.48	ND*	ND*	10.63	ND*	10.36	ND*	20	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Lead as Pb	µg/m ³	ND*	ND*	0.61	ND*	ND*	0.66	ND*	0.77	ND*	01	CPCB Guidelines for AQIM (Vol. I, NAAQM/36/2012-13)
Hydrocarbon as HC	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	N/A	Digital Gas Analyser
Hydrochloric Acid as HCl	µg/m ³	24.33	21.15	25.63	29.65	26.43	22.68	18.21	29.66	23.64	45*	IS 5182 (Part-19)
Chlorine	µg/m ³	21.16	17.48	22.65	26.35	24.96	20.24	ND*	25.68	18.64	N/A	IS 5182 (Part-19)
Hydrogen Sulphide as H ₂ S	µg/m ³	ND*	ND*	0.41	ND*	ND*	ND*	ND*	ND*	ND*	N/A	IS 5182 (Part-7)

Note: Limits* as per Industrial, Institutional, Rural and other Area Notification Dated 18th Nov.2009 as per national Ambient Air Quality Standards, CPCB Recommendations.
S: (Saree (Dy) sampling duration 1 hr and sample Analyzed on same Day. Carbon Monoxide (CO): Sampling 1 Hr.
ND*: Not Detected; Detection Limit, Benzene (a) Pyrene (BaP)- particulate phase only: 0.5 ng/m³; Benzene (a) Pyrene: 0.5 ng/m³; Hydrocarbon as HC (a) Pyrene: 0.5 ng/m³; Hydrogen Sulphide as H₂S: 0.5 µg/m³; Arsenic: 2 µg/m³; Chlorine: 15.0 µg/m³; Lead as Pb: 0.1 µg/m³; Nickel as Ni: 0.1 µg/m³.

Ravi Jariwala
Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai
Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.

End of Report

* Recognition Scheme
Govt. (Pollution) Act, 1986 (CPCB)

* Recognition Scheme
Govt. (Pollution) Act, 1986 (CPCB)

* ISO 9001 : 2015 / 45001
Waste Water Guidelines 2022

* ISO 9001 : 2015 / 45001

*Pollucon (India) Pvt. Ltd., Plot No. 8 & 9, Opp. Datta Industrial Soc., Old Chhatrasani Bldg Area, Hasjaga Drive, Dattas Nagar, Road, Surat 395007, Gujarat, India.
Phone : 9221-263256/175, No. 7888 65174, 70482 91700, 96568 : www.polluconlab.com, E-mail : pollucon@gmail.com, qportal@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST REPORT FOR AMBIENT AIR QUALITY MONITORING

Q5/7.020-AQ
Page 1 of 1

Customer's Name and Address :

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 676 600

Test Report No. : **PL/AP/25/04/0021**
Issue Date : **02/05/2025**
Customer's Ref : **PO. No. 0015413035**
Dated: 27/03/2025

Location of Sampling : **ETP**
Date of Sampling : **As per table** Sampling Procedure : **As per table**
Sampling By : **Pollucon Laboratories Pvt. Ltd.** Protocol (Purpose) : **Ambient Air Quality Monitoring**
Sampling Duration : **24 Hrs.** Lab Id : **As per table**

TEST PARAMETER	UNIT	DATE OF SAMPLING										LIMIT*	TEST/ SAMPLING METHOD
		01/04 /2025	04/04 /2025	08/04 /2025	11/04 /2025	15/04 /2025	18/04 /2025	22/04 /2025	25/04 /2025	28/04 /2025			
Lab ID ASA/2504 (A-M)		02	15	19	22	31	35	44	52	56			
Respirable Particulate Matter (PM ₁₀)	µg/m ³	74.16	63.33	86.37	73.58	64.18	83.22	76.64	84.63	68.67	100	IS 5182 (Part 2)	
Particulate Matter (PM ₁₀)	µg/m ³	38.87	29.37	45.37	40.29	33.43	47.74	41.53	46.95	34.53	60	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 15)	
Sulphur Dioxide as SO ₂	µg/m ³	12.32	15.42	13.13	17.55	21.98	14.51	18.59	22.27	16.35	10	IS 5182 (Part-2)	
Oxides of Nitrogen as NO ₂	µg/m ³	77.57	28.36	26.38	36.44	33.45	31.27	29.57	34.30	27.43	80	IS 5182 (Part-4)	
Ozone (O ₃) ^a	µg/m ³	16.30	19.13	28.42	18.30	30.62	24.42	21.52	25.56	23.17	180	IS 5182 (Part-9)	
Carbon Monoxide as CO	mg/m ³	0.59	0.61	0.21	0.74	0.80	0.49	0.88	0.73	0.42	10	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 23)	
Ammonia as NH ₃	µg/m ³	23.34	20.52	18.14	21.42	25.56	19.42	17.61	21.48	26.92	400	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 15)	
Benzene as C ₆ H ₆	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	03	IS 5182 (Part-11)	
Benzo (a) Pyrene (BaP)- Particulate Phase Only	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 15)	
Arsenic as As	ng/m ³	ND*	ND*	2.22	ND*	ND*	2.13	ND*	2.35	ND*	06	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 15)	
Nickel as Ni	ng/m ³	ND*	ND*	10.23	ND*	ND*	10.35	ND*	10.27	ND*	20	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 15)	
Lead as Pb	µg/m ³	ND*	ND*	0.51	ND*	ND*	0.56	ND*	0.64	ND*	01	CPC Guidelines for AQIM (Vol. 1, MANQMS/06/2012- 23)	
Hydrocarbon as HC	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	NS*	Digital Gas Analyser	
Hydrochloric Acid as HCl	µg/m ³	16.13	20.15	16.11	21.34	25.07	17.72	22.03	26.26	19.22	NS*	SOP-ACI-01	
Oxofine	µg/m ³	ND*	16.62	ND*	17.35	21.54	ND*	18.16	27.86	15.37	NS*	IS 5182 (Part 19)	
Hydrogen Sulphide as H ₂ S	µg/m ³	ND*	ND*	8.66	ND*	6.55	ND*	ND*	ND*	ND*	40*	IS 5182 (Part-7)	

ND*: Less than detection limit. Residual, Total and other data not shown. Data in this report is per national Ambient Air Quality Standards, CPCB Method.

NS: Noise. O₃ sampling duration 1 hr and single reading for each day. Carbon Monoxide (CO) Sampling 3 hr.

ND*: Not Detected, Detection Limit, Benz (a) Pyrene (BaP) - particulate phase only: 0.5 ng/m³; Benzene as C₆H₆: 3.0 µg/m³; Hydrocarbon as HC: 50 µg/m³;
Hydrogen Sulphide as H₂S: 6.0 µg/m³; Arsenic: 2 µg/m³; Oxofine: 15.0 µg/m³; Lead as Pb: 0.1 µg/m³; Nickel: 0.0 µg/m³

Ravi Jarwal
Sr. Environmental Scientist

Dr. Arun Rajpal
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned aforesaid.

End of Report

* Recognized Env. Lab under

Env. Protection Act-1986 (CPCB)

* Recognized Software

Env. Auditor (CPCB)

* ISO 9001:2015 Approved for

Water Quality Guidelines V.2.2

* ISO 9001:2015 & ISO 14001:2015

"Pollucon House", Plot No. 3 & 4, Opp. Dabhi Industrial Soc., Old Ghantghar Stn, MB Lane, Nanjvan Circle, Dahana Nagar Road, Surat-393007, Gujarat, India.
Phone: 9861-263575/981975, No. 70100 60174, 70402 61755, WEB: www.polluconlab.com, E-mail: pollucon@gmail.com, qac@polluconlab.com

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

QF/7.8/20-AD
Page: 1 of 1

M/S. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL. NO. (02645) 628 000

Test Report No. : PL/AP/25/04/0022
Issue Date : 02/05/2025
Customer's Ref. : PO. No. QD15413035
Dated: 27/03/2025

Location of Sampling	Canteen	Sampling Procedure	As per table
Date of Sampling	As per table	Protocol (Purpose)	Ambient Air Quality Monitoring
Sampling By	Pollucon Laboratories Pvt. Ltd.	Lab Id	As per table
Sampling Duration	24 Hrs.		

TEST PARAMETER		UNIT	DATE OF SAMPLING									LIMIT*	TEST/ SAMPLING METHOD
			01/04 /2025	04/04 /2025	08/04 /2025	11/04 /2025	15/04 /2025	18/04 /2025	22/04 /2025	25/04 /2025	29/04 /2025		
Lab ID 45A/2504	A-HI		03	16	20	28	32	36	45	53	57		
Respirable Particulate Matter (PM ₁₀)	µg/m ³	60.67	51.47	64.33	69.35	58.37	79.28	66.63	74.65	63.66	100	IS 5182 (Part-23)	
Particulate Matter (PM _{2.5})	µg/m ³	34.40	22.83	31.37	14.66	25.66	49.02	32.54	40.62	30.45	50	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Sulphur Dioxide as SO ₂	µg/m ³	16.18	14.31	8.49	10.63	16.21	11.65	9.50	17.43	10.64	40	IS 5182 (Part-5)	
Oxides of Nitrogen as NO _x	µg/m ³	19.53	21.63	24.32	27.66	29.49	17.14	15.70	30.43	16.72	80	IS 5182 (Part-6)	
Ozone (O ₃)	µg/m ³	21.26	27.27	24.54	20.28	11.53	14.43	19.66	17.32	15.53	180	IS 5182 (Part-9)	
Carbon Monoxide as CO	mg/m ³	0.79	0.68	0.85	0.50	0.73	0.47	0.65	0.56	0.26	04	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Ammonia as NH ₃	µg/m ³	18.45	25.46	13.13	17.30	14.85	12.26	15.86	24.64	19.66	400	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Benzene as C ₆ H ₆	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	05	IS 5182 (Part-11)	
Benz[a] Pyrene (BaP)- Particulate Phase Only	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Arsenic as As	mg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	06	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Nickel as Ni	mg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	20	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Lead as Pb	mg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	CPCB Guidelines for AQMN (Vol. 1, NAAQS/94/2012-13)	
Hydrocarbon as HC	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	NS*	Digital Gas Analyzer	
Hydrochloric Acid as HCl	µg/m ³	71.46	18.13	12.06	16.86	19.57	15.63	11.52	20.92	14.57	NS*	SOP HCL - 01	
Chlorine	µg/m ³	16.44	ND*	ND*	ND*	15.51	ND*	ND*	17.77	ND*	NS*	IS 5182 (Part-13)	
Hydrogen Sulphide as H ₂ S	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	NS*	IS 5182 (Part-7)	

[illegible]

Rawl Jaywan
Sr. Environmental Scientist

Dr. Arun Sajpai
Lab Manager (D)

Note: This report is subject to terms & conditions mentioned overleaf

End of Report

Recognized Env. Act. under
Env. Protection Act-1986 (EPA)

■ **Neighborhood Solutions** Neighborhood Solutions
 11100 Harding Rd. #301
 Dallas, TX 75243-4400
 214/343-7300
 Fax: 214/343-7301
 E-mail: info@nsolutions.com
 Web: www.nsolutions.com

2014 Approved (1.1)
Welding Guidelines: 3.5.2

● JANUARY 1991

Polycare House[®], Plot No. 5 & 6, Opp. Bafra Industrial Soc., Old Charhath 24 MW Lane, Nar, and Circle, Ultra Magdalla Road, Durg-355007, Gujarat, India.
Phone: 0981-263750/9175, Mo. 99986 0874, 70402 47750, MGN. www.polycareintl.com, E-mail: polycare@nars.com, enquiries@polycareintl.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



POLLUCON LABORATORIES PVT. LTD.

TEST REPORT FOR AMBIENT AIR QUALITY MONITORING

QF/7.020-AQ
Page: 1 of 3

Customer's Name and Address:

M/S, ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : PL/AP/25/04/0023
Issue Date : 02/05/2025
Customer's Ref : PO. No. 0015413035
Dated: 27/03/2025

Location of Sampling : Admin Building
Date of Sampling : As per table
Sampling By : Pollucon Laboratories Pvt. Ltd.
Sampling Duration : 24 Hrs.
Sampling Procedure : As per table
Protocol (Purpose) : Ambient Air Quality Monitoring
Lab Id : As per table

RESULTS TABLE

TEST PARAMETER	UNIT	DATE OF SAMPLING										LIMIT*	TEST/ SAMPLING METHOD
		01/04 /2025	04/04 /2025	08/04 /2025	11/04 /2025	15/04 /2025	18/04 /2025	22/04 /2025	25/04 /2025	29/04 /2025			
Lab ID: ASA/2504 [A-M]		04	17	21	25	11	17	40	54	58			
Respirable Particulate Matter (PM ₁₀)	µg/m ³	65.62	55.63	74.34	55.01	72.55	64.48	73.03	66.57	80.47	100	IS 5182 (Part-23)	
Particulate Matter (PM _{2.5})	µg/m ³	31.54	38.62	35.87	25.62	39.53	30.83	34.33	37.58	43.41	60	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Sulphur Dioxide as SO ₂	µg/m ³	8.37	10.33	15.47	11.35	29.42	17.29	13.96	16.19	12.54	80	IS 5182 (Part-2)	
Oxides of Nitrogen as NO _x	µg/m ³	17.63	15.36	20.41	22.36	27.86	24.35	19.51	26.34	23.42	80	IS 5182 (Part-6)	
Ozone (O ₃)	µg/m ³	18.45	24.66	17.51	14.63	23.85	19.51	12.68	20.34	13.73	180	IS 5182 (Part-6)	
Carbon Monoxide as CO	mg/m ³	0.64	0.56	0.45	0.70	0.57	0.34	0.52	0.58	0.71	04	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Ammonia as NH ₃	µg/m ³	18.88	28.65	12.97	15.47	19.57	17.86	13.67	16.38	20.14	900	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Benzene as C ₆ H ₆	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	05	IS 5182 (Part-11)	
Benzo (a) Pyrene (BaP)- Particulate Phase Only	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Arsenic as As	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	06	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Nickel as Ni	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	20	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Lead as Pb	ng/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	01	OPC Guidelines for AQIM (Vol. I, NMAQMS/36/2012-13)	
Hydrocarbon as HC	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	NS*	Digital Gas Analyser	
Hydrochloric Acid as HCl	µg/m ³	11.33	13.93	19.42	15.66	22.42	20.53	17.16	23.45	16.23	NS*	SOP HCl - 01	
Chlorine	µg/m ³	ND*	ND*	ND*	ND*	10.24	15.87	ND*	15.34	ND*	NS*	IS 5182 (Part-19)	
Hydrogen Sulphide as H ₂ S	µg/m ³	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	ND*	NS*	IS 5182 (Part-7)	

Notes: 1. Limit: IS 5182 Industrial, Residential, Rural and other Area Notification District Level, New 2012 as per respective State Air Quality Standard, IS 5182 New 2012.
2. Ozone (O₃): Sampling Duration 1 Hr and sample Analyzed on same Day. Carbon Monoxide (CO): Sampling 2 Hrs.
ND*: Not Detectable, Reduction Limit, Benzene (C₆H₆), Particulate phase as BaP: 1.0 µg/m³, Benzene as O₃: 2.0 µg/m³, Hydrocarbon as HC: 1.0 µg/m³,
Hydrogen Sulphide as H₂S: 0.05 µg/m³, Ammonia: 2.0 µg/m³, Chlorine: 15.0 µg/m³, Lead as Pb: 0.1 µg/m³, Nickel: 5.0 µg/m³

Ravi Jain
Sr. Environmental Scientist

Dr. Arun Bajpai
Lab Manager (Q)

Note: This report is subject to terms & conditions mentioned overleaf.

End of Report

● Designated Env. Lab. Center
Pun. (Protection) Act-1986 (CPCB)

● Recognition Certificate 1
Pun. Act 1986 (CPCB)

● 24018 Approved for
NMAQMS Guidelines V2.3

● 1-61 9931 / 14001 / 49 01

"Pollucon House", Plot No. 5 & 6, Opp. Balaji Industrial Soc., OM Shastri Sahi Mill Lane, Navjeevan Circle, Vidhaya Marg, Road, Surat-395007, Gujarat, India.
Phone : 0264-2635755/5175, Mo. 70168 05174, 70462 61750, WEB : www.polluconlab.com, E-mail : pollucon@gmail.com, queries@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure J

TSDF membership certificate

Membership Certificate

Bharuch Enviro Infrastructure Limited (BEIL) – Common Incineration Facility



BHARUCH ENVIRO INFRASTRUCTURE LIMITED

October 31, 2025

M/s. Asian Paints Ltd. (Paint Div.)
Plot No. 2602,
GIDC, Ankleshwar.

Sub : Membership Certificate for Common Incineration Facility.

Dear Sir,

We hereby certify that you have become member for the common incineration facility of Bharuch Enviro Infrastructure Ltd. at GIDC, Ankleshwar. You have booked quantity of 156 MT/Year. Your Membership No. is CH/Ank.033.

Thanking you

Yours faithfully,
For BHARUCH ENVIRO INFRASTRUCTURE LTD.


AUTHORISED SIGNATORY



Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Membership Certificate

Bharuch Enviro Infrastructure Limited (BEIL) – Common Solid Waste Disposal



BHARUCH ENVIRO INFRASTRUCTURE LIMITED

October 31, 2005

M/s. Asian Paints Ltd. (Paint Div.)
Plot No. 2602,
GIDC, Ankleshwar.

Sub : Membership Certificate for Common Solid Waste Disposal Facility.

Dear Sir,

We hereby certify that you have become member for the common Solid/Hazardous waste disposal facility of Bharuch Enviro Infrastructure Ltd., at GIDC, Ankleshwar. You have booked solid waste quantity of 500 MT/year. Your Membership No. is Ank./092.

Thanking you,

Yours faithfully,
For BHARUCH ENVIRO INFRASTRUCTURE LTD.

—AUTHORISED SIGNATORY



Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure K

Manifest copies for haz waste disposal

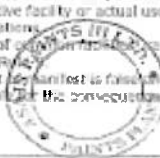




**BEIL INFRASTRUCTURE
LIMITED [14983]**

Manifest No:
2908664
26/04/2025

Copy 1

To be forwarded by To be forwarded by the occupier to the State Pollution Control Board or Committee.

Sender's Details			
Sender Name	Asian Paints Ltd. [14983]		
Address	Tolake GIDC District:ANK Pin no:393002		
Contact Details	9350700011	GPS Coordinates	Lat:21.02153350186 Lon:73.026039113128
Guardian Detail	-		
Receiver's Details			
State	Gujarat	Type of Facility	Common TPOF
Receiver Details	BEIL INFRASTRUCTURE LIMITED [14983]		
Contact Details	9350700011	GPS Coordinates	Lat:21.51625500533978 Lon:73.01692907902906
Address	--- 9401-9412,9501-9506,7901 E to H, GIDC Ankleshwar, --- Taluka:ANK District:ANK Pin no:393002		
Waste Details			
Waste Details	In Tanks: 0x Chemical sludge from waste water treatment		
Waste Intended for	Landfill	Total Qty	12.000MT Consistency Solid
Transporter Details			
Name	PURVA ENTERPRISE	Contact Details	9888510351 purvaenterprise@gmail.com
Address	29, Anandpur Industrial Estate, Ankleshwar District:Ankleshwar Taluka:Ankleshwar		
Vehicle Details			
Vehicle no	GJ01/1441 (DPED No:05081308022727)	GPS Enabled	Yes Type of Vehicle Truck
Driver name	MANISH SHAH	Driver Contact No	9271406790
Waste Transportation Details			
Vehicle Depart	26/04/2025 2:10PM	Trip Start	26/04/2025 1:40PM No of Drums 0 Loose Waste 12.000
Remarks	ETP Sludge	No of bags	0
Sender's Declaration: (1) The above contents of hazardous/ other wastes consignment are fully and accurately described above by proper shipping name and are categorized, packed, marked and labeled, and are in all respects in proper conditions for its transport from the mentioned location to common facility or rapine facility or actual user by way of road/ transportation in accordance with the applicable control as well as state government regulations. (2) I have obtained membership of common facility, entered into agreement with actual user for disposal/ actual use of hazardous waste having authorization under Rule-5. (3) I do hereby certify that no part of manifest is false and nothing has been concealed. If any information appears to be false or concealed, I will be held responsible for the consequences under HGW Rules, 2016 and amendments thereof. Name and stamp of sender:  Date: 26/4/25 Signature: 			
Transporter's Acknowledgement of Receipt of waste Stamp: PURVA ENTERPRISE Date: 26/4/25 Signature: 			
Receiver's Certification of Receipt of Hazardous waste I, hereby declare that the said waste is received at the facility/unit for which I have valid SCA (under Rule-5 in case of recycling/ for disposal/ utilization). I also declare this information to be true taking which I will be held responsible for the consequences under HGW Rules, 2016 and amendments thereof. I hereby, accept/ reject the manifest.			

Stamp: Date: Signature:

By scanning QR code, copy of transporter will be displayed. (All copy has same information)

Printed by 1497 on 26/04/2025 09:49:35 PM File: 2608664-0811-4871-0504-07201117a18

Page 1 of 1

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



**BEIL INFRASTRUCTURE
LIMITED [14983]**

**Manifest No:
2915281
02/05/2025**

Copy 1

To be forwarded by To be forwarded by the occupier to the State Pollution Control Board or Committee

Sender's Details			
Sender Name	Asian Paints Ltd. [14937]		
Address	, Talsar, ANK, Dist: ANK, Pin no. 393002		
Contact Details	9665270903 malay.manikod@asianpaints.com	GPS Coordinates	Lat: 21.621513501961425 Long: 72.925816142428
Guardian Detail			
Receiver's Details			
State	Gujarat	Type of Facility	Common TSDF
Facility Details	BEIL INFRASTRUCTURE LIMITED [11111]		
Contact Details	913949994 shahadad3001@gmail.com	GPS Coordinates	Lat: 21.61626093533974 Long: 72.94852404502006
Address	--- 9401 9412 9501 9506, Palsi Bida M, GIDC, Ankleshwar, --- Talsar, ANK, Dist: ANK, Pin no. 393002		
Waste Details			
Waste Details	I-35-35.3-Chemical sludge from waste management		
Waste Intended for	Landfill	Total Qty	12.673MT Consistency Solid
Transporter Details			
Name	MURVA ENTERPRISES	Contact Details	9222272216 purvitransport31@gmail.com
Address	29, Swagatham Road, Ankola District, Ankleshwar Taluka, Ankleshwar		
Vehicle Details			
Vehicle no.	GJ06W1741 (H.V. No. J58137864552245)	GPS Enabled	Yes Type of Vehicle Truck
Driver name	VIRAG	Driver Contact No	9027760377
Waste Transportation Details			
Vehicle Depart.	02/05/2025 11:06AM	Trailer Start	02/05/2025 11:06AM No of Drums 0 Consistency MT 12.670
Remarks	ETP SLUDGE	No of bags	0
Sender's Declaration : (1) The above contents of hazardous or other wastes management are fully and accurately described above by proper shipping name and are categorical, product, material and labeled, and are in all respects in proper conditions for its transport from the mentioned location to common facility or approved facility or approved user by way of road/ transportation in accordance with the applicable central as well as state government regulations. (2) I have obtained membership certificate from the transporter's agreement with actual user for disposal/ actual use of hazardous waste having authorization under E-9. (3) I do hereby verify that no part of manifest is false and nothing has been concealed. If any information proves to be false or concealed, I will be held responsible for the consequences under EGM Rules, 2016 and amendments thereof.			
Name and stamp of sender		Date: 02.05.2025	Signature:
Transporter's Acknowledgement Receipt of waste Stamp: A-78 Ganesha Park Residency under Park C, D.C. Ankleshwar		Date: 02.05.2025	Signature:
Receiver's Certification of Receipt of Hazardous waste I, hereby declare that the said waste is received at the facility/ user for which I have valid OCA (under Rule-9 in case of recycling) for its disposal/ utilization. I also declare this information to be true failing which I will be held responsible for the consequences under EGM Rules, 2016 and amendments thereof. I hereby accept/ reject the manifest.			

Stamp:

Date:

Signature:

By scanning QR code, copy of transporter will be display. (All copy has same information)

Print by 14337 of 02/05/2025 13:16:15 PM

56747cbc-9946-45d3-a13d-d6d5789a6d70

Page 1 of 1

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



**BEIL INFRASTRUCTURE
LIMITED [14963]**

**Manifest No:
2948473
03/06/2025**

Copy 1

To be forwarded by the occupier to the State Pollution Control Board or
Communities.

Sender's Details				
Sender Name	Asian Paints Ltd. [14963]			
Address	Tatka : ANK District: ANK Pin no: 393002			
Contact Details	9925270303 mailto:manishk@asianpaints.com	GPS Coordinates	Lat: 21.67551156; 106.1436 Long: 73.025331612129	
Guardian Detail				
Receiver's Details				
Entity	BEIL	Type of Facility	Common TSU	
Facility Details	BEIL INFRASTRUCTURE LIMITED, Tatka			
Contact Details	971040560 delwadi@beil.co.in	GPS Coordinates	Lat: 21.616089933; 110.75 Long: 73.04882407502906	
Address	9901-9412, 9901-9506, 9905 E 90 H, CHC, Ankleshwar, -- Tatka : ANK District: ANK Pin no: 393002			
Waste Details				
Waste Details	[1]-[15]-[25] 5-Chemical sludge from waste water treatment			
Waste Intended for	Landfill	Total Qty	17.200MT	Consistency Solid
Transporter Details				
Name	PURVA ENTERPRISE		Contact Details	9408012037 purvaenterprise73@gmail.com
Address	70 Gansabhai Resident, Sander Park District: Ankleshwar Tatka: Ankleshwar			
Vehicle Details				
Vehicle No	GJ 18N1753 (PRET No: 8001700444724)	GPS Enabled	Yes	Type of Vehicle Truck
Driver Name	VEDAS	Driver Contact No	9327763177	
Waste Transportation Details				
Vehicle Depart	01/06/2025 1:35PM	Trig. Start	04/06/2025 12:57PM	No of Drivers 0
Remarks	ETP SLUDGE		No of bags	0
Sender's Declaration : (1) The above contents of hazardous/ other wastes (as mentioned) are fully and accurately described above by proper shipping name and are categorized, packed, marked and labeled as per all respects in proper conditions for its transport from aforementioned location by common facility or contract facility by way of road/transportation in accordance with the applicable central as well as state government regulations. (2) I have obtained membership of common facilities and our agreement with actual user for storage/ actual use of hazardous waste having authorization under Rule 17. (3) I do hereby declare that no part of manifest is false or misleading has been concealed. If any information appears to be false or concealed, I will be held responsible under the provisions of the HWM Rules, 2016 and amendments thereof.				
Name and stamp of sender:		Date:	3/6/25	
Signature:		[Signature]		
Transporter's Acknowledgement of Receipt of Waste				
Stamp:	PURVA ENTERPRISE A 70, Gansabhai Resident		Date:	3/6/25
Signature:		[Signature]		
Receiver's Declaration:				
I, hereby declare that the said waste is received at the facility/unit for which I have valid ICA (under Rule-9 in case of receipt) for its disposal/ utilization. I also declare this information to be true (wherein I will be held responsible for the consequences under HWM Rules, 2016 and amendments thereof) Legally, correctly received the material.				

Stamp:

Date:

Signature:

By scanning QR code, copy of transporter will be display. (All copy has same information)

Printed by: 14912 on 03/06/2025 (8:54:17 PM) 24d346185-6ba9-47d1-aac07-70536675029d

Page 1 of 1

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure L

Haz waste coprocessing data

Haz waste disposal for the period of Apr'25 to Sep'25		
Month	Haz waste qty (in MT) disposed through coprocessing/Pre-processing	Coprocessing/Pre-processing disposal Site
Apr-25	15.71	J.K Cement Ltd, Mangrol, Rajasthan.
May-25	12.20	J.K Cement Ltd, Mangrol, Rajasthan.
Jun-25	9.17	J.K Cement Ltd, Mangrol, Rajasthan.
Jul-25	8.30	J.K Cement Ltd, Mangrol, Rajasthan.
Aug-25	19.41	J.K Cement Ltd, Mangrol, Rajasthan.
Sep-25	6.73	BEIL INFRASTRUCTURE LIMITED, Ankleshwar
	3.85	J.K Cement Ltd, Mangrol, Rajasthan.
Total	75.37	

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure M

MSIHC data

Sr. No.	Category	Criterion	Threshold Quantities (Tons)		Stock oh hand
			Lower	Higher	
1	Flammable Liquids	60 < F.P < 90	5000	50000	20.116
2	Highly Flammable liquids which remains liquid under pressure	23 < F.P <= 60	25	200	0
3	Highly Flammable Liquids	23 < F.P <= 60	2500	20000	795.417
4	Very highly flammable liquids	FP <= 23 , B.P > 35	1500	10000	261.709
5	Extremely flammable liquids	FP <= 23, B.P < 35	1000	5000	NA
6	Flammable Gases	LEL<=13% at 20Degree C and STP 101.3 Kpa	15	200	<41 kg
7	Toluene di-isocyanate (TDI)		10	100	0.000
8	Ammonia		60	600	5.681
9	Highly Flammable liquids as Per Schedule 3 Part 2 (GFR)		1000	5000	189.400
9	Acetylene (ethyne)		5	NA	0
10	Hydrogen		2	50	2 Cylinder of H2

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure N

List of fire extinguishers

BLOCK WISE LOCATION	NUMBER OF FIRE EXTINGUISHER
IPB	100
RMG-2	48
WPB	59
EIRS	35
RMG-3	38
BSR	37
SPB	92
RMG-1	40
RHPB	120
Other Scrap area	139
Admin	30
New Plot	62
Dispatch center	30
Sanitizers	37
Fire Stores	199
Total number of fire extinguishers	1066

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure O

Half Yearly Medical Report



Medical Examination Form

Demographic Information			
EMP ID	:	135465	SR NO: 194
Name	:	Aneesh Kunjumon Charuvila	Date: 04/06/2025
Age/ Sex	:	25 YRS./MALE	
Department	:	HR	
ID MARK	:	MOLE ON RT HAND MIDDLE FINGER	
VITALS CHECKUP			
Blood Pressure: -	120/80 mm Hg	HEIGHT (IN CM): -	168
Heart Rate: -	70 Per min	Weight (IN KGS): -	77.1
Spo2: -	99 %	BMI VALUE: -	27.3 kg/m ²
PULSE: -	70 min Regular	BMI STATUS: -	OVERWEIGHT
HISTORY			
Current Health Complaints	NO		
Past History	NO		
Family History	DM-FATHER		
Allergies	NO		
Ongoing Medication	NO		
Vertigo, Epilepsy and Height Phobia	NAD		
Nasal Discharge & Nail Examination	N.A		
EYE TEST			
1. VISION			
A. NEAR VISION		B. DISTANCE VISION	
RIGHT EYE: -	N-6	RIGHT EYE: -	6\6
LEFT EYE: -	N-6	LEFT EYE: -	6\6
2. COLOR VISION			
RIGHT EYE: -	WNL		
LEFT EYE: -	WNL		
3. TORCH LIGHT EXAMINATION			
RIGHT EYE: -	NAD		
LEFT EYE: -	NAD		
Peripheral Vision Test: -	NAD		
REMARKS: -	-		
Revival Diagnostics Dr. Rahul D Pujara MBBS, CMI Medical Officer Regd. No. G-50107		DOCTOR'S SIGNATURE 	

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
0261 2747788, 9825947712 revivaldiagnostics.surat@gmail.com www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

CBC - 05062541 Released at 06-Jun-2025 05:05 PM

Parameter	Result	Biological Ref.Range	Method
-Haemoglobin	14.6 gm/dL	(13.5 - 18 gm/dL)	Auto
-RBC Count	5.05 mill/cumm	(4.6 - 6.2 mill/cumm)	Auto
-Total WBC Count	8800 /cumm	(4000 - 10000 /cumm)	Auto
-Platelet Count	3.09 lakh/cumm	(1.5 - 4.5 lakh/cumm)	Auto

Blood Indices

-HCT	45.6 %	(40 - 55 %)	Auto
-MCV	90.3 fl	(80 - 92 fl)	Auto
-MCH	29.0 pg	(27 - 31 pg)	Auto
-MCHC	32.1 gm/dL	(32 - 36 gm/dL)	Auto
-RDW	13.2 %	(11 - 15 %)	Auto

Diff WBC Count

-Polymorphs	66 %	(40 - 80 %)	Microscopically
-Lymphocytes	28 %	(20 - 40 %)	Microscopically
-Eosinophils	04 %	(1 - 6 %)	Microscopically
-Monocytes	02 %	(2 - 7 %)	Microscopically
-Basophils	00 %	(0 - 1 %)	Microscopically
-PLATELET ON SMEAR	Adequate		Microscopically
-MALARIAL PARASITES	Malarial Parasites Not Detected		Microscopically

[Test performed on Fully Automated Hematology Analyzer ERBA H-360]

Revival Diagnostics

401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009. Mo. 9825947712


Dr. Shivangi Gandhi
M.B.B.S, M.D (Pathology)

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

REVIVAL
DIAGNOSTICS



Name	Aneesh Kunjumon Charevila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

RBS - 050625295 Released at 09-Jun-2025 11:06 AM

Parameter	Result	Biological Ref.Range	Method
-RBS	89 mg/dL	(70 - 140 mg/dL)	GOD - POD
-RANDOM URINE SUGAR	Absent		
-RANDOM URINE ACETONE	Absent		

HbA1C - 050625294 Released at 09-Jun-2025 11:09 AM

Parameter	Result	Biological Ref.Range	Method
-HbA1C	5.2 %	HbA1C Degree of Glucose Control <5.7 % Non Diabetics 5.7 - 6.4 % Prediabetics >=6.5 % Diabetics (REF:Wallace, 11th Edition) REMARKS: 6 - 7 % Excellent Control 7 - 8 % Good Control 8 - 10 % Unsatisfactory Control >10 % Poor Control	HPLC
-Mean Blood Glucose	103 mg/dL		Calculated
-Instrument	TRIVIRRON- NANO H5 (HPLC)		

Revival Diagnostics
401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009 Mo. 9825947712


Dr. Shivangi Gandhi
M.B.B.S, M.D (Pathology)

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

Lipid Profile - 050625296 Released at 07-Jun-2025 04:31 PM

Parameter	Result	Biological Ref.Range	Method
-Serum Cholesterol	122 mg/dL	Desirable < 200 mg/dl Borderline High : 200-239 mg/dl High : > 240 mg/dl	CHOD-PAP
-Serum Triglyceride	80 mg/dL	Normal < 150 mg/dl Borderline High : 150 - 199 mg/dl High : 200 - 499 mg/dl Very High : 500 mg/dl	GPO-POD Method
-Serum HDLD(Direct)	37 mg/dL	Normal :> 55 mg/dl Borderline : 35-55 mg/dl Undesirable: < 35 mg/dl	PVS-PEGME Precipitation with CHOD-POD
-Serum VLDL	16 mg/dL	(5 - 30 mg/dL)	Calculated
-Serum LDLD	69 mg/dL	Optimal:< 100 mg/dl Above Optimal : 100- 129 mg/dl Borderline High : 130-159 mg/dl High : > 160-189mg/dl Very High : >190 mg/dl	Calculated
-Chol/HDL	3.30	Low risk: <3.8 Medium Risk: 3.8 to 5.9 High Risk: > 6	Calculated
-LDL/Chol	1.77	Low risk: <3.55 Medium Risk: 3.55 to 4.0 High Risk: > 6	Calculated

[Test performed on Fully Automated Biochemistry Analyzer ERBA EM200]

Revival Diagnostics

401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009. Mo. 9825947712


Dr. Shivangi Gandhi
M.B.B.S, M.D (Pathology)

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

Total T3 T4 TSH - 050625296 Released at 08-Jun-2025 01:05 PM

Parameter	Result	Biological Ref.Range	Method
-Total T3	1.49 ng/ml	(0.87 - 1.78 ng/ml)	Fluorescence Enzyme Immunoassay
-Total T4	8.66 ug/dl	(4.6 - 11 ug/dl)	Fluorescence Enzyme Immunoassay
-TSH	1.63 uIU/ml	0.50 - 5.50 uIU/ml 5.5 to 15 uIU/ml - Suggested Clinical co-relation or Repeat test with new sample as physiological factors can give falsely high TSH Above 15uIU/ml Hypothyroid PREGNANT WOMEN normal ranges for TSH: 1st Trimester : 0.0878 - 2.8293 uIU/ml 2nd Trimester : 0.1998 - 2.7915 uIU/ml 3rd Trimester : 0.307 - 2.9028 uIU/ml Ref: TIETZ Fundamentals of Clinical Chemistry	Fluorescence Enzyme Immunoassay

[Test performed on Fully Automated Immunology Analyzer Maglumi-600]

Revival Diagnostics

401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009. Mo. 9825947712


Dr. Shivangi Gandhi
M.B.B.S, M.D (Pathology)

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.

0261 2747788, 9825947712 revivaldiagnostics.surat@gmail.com www.revivaldiagnostics.com

This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

Bilirubin - 050625296 Released at 07-Jun-2025 03:19 PM

Parameter	Result	Biological Ref.Range	Method
-Serum Total Bilirubin	0.4 mg/dL	(0 - 1.3 mg/dL)	DIAZO
-Serum Direct Bilirubin	0.2 mg/dL	(0 - 0.4 mg/dL)	DIAZO
-Serum Indirect Bilirubin	0.2 mg/dL	(0.1 - 1.3 mg/dL)	Calculated

SGPT - 050625296 Released at 07-Jun-2025 03:08 PM

Parameter	Result	Biological Ref.Range	Method
-SGPT(ALT)	14 U/L	(5 - 45 U/L)	IFCC, Kinetic Without Pyridoxal Phosphate

SGOT - 050625296 Released at 07-Jun-2025 03:54 PM

Parameter	Result	Biological Ref.Range	Method
-SGOT (AST)	15 U/L	(0 - 35 U/L)	IFCC, Kinetic Without Pyridoxal Phosphate

Creatinine - 050625296 Released at 07-Jun-2025 03:16 PM

Parameter	Result	Biological Ref.Range	Method
-Creatinine	0.8 mg/dL	(0.6 - 1.4 mg/dL)	ENZYMATIC

BUN - 050625296 Released at 07-Jun-2025 03:34 PM

Parameter	Result	Biological Ref.Range	Method
-Blood Urea Nitrogen (BUN)	8 mg/dL	(6 - 20 mg/dL)	Calculated

Revival Diagnostics

401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009. Mo. 9825947717


Dr. Shivangi Gandhi
M.B.B.S, M.D (Pathology)

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pai, Surat-395009.
☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

REVIVAL
DIAGNOSTICS



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	05-Jun-2025 08:23 AM

Urine Routine & Micro Examination - 050625297 Released at 05-Jun-2025 06:14 PM

Parameter	Result	Biological Ref.Range	Method
Physical Examination			
-Quantity	30		Manual
-Colour	Dark Yellow	Pale Yellow	Manual
-Appearance	Clear	Clear	Manual
-Reaction (pH)	Acidic		Dipstick
-Specific Gravity	1.030		Dipstick
Chemical Examination			
-Proteins.	Absent		Dipstick
-Sugar	Absent		Dipstick
-Acetone.	Absent		Dipstick
-Bile Salts	Absent	Absent	Dipstick
-Bile Pigments	Absent	Absent	Dipstick
-Occult Blood Test (OBT).	Negative		Dipstick
Microscopic Examination			
-Pus Cells	1-2/hpf.		Microscopically
-Red Blood Cells	Absent		Microscopically
-Epithelial Cells	Occasional		Microscopically
-Bacteria.	Absent		Microscopically
-Casts	Absent	Absent	Microscopic Examination
-Crystals	Absent	Absent	Microscopically
-Others	NIL	Absent	Microscopic Examination

Revival Diagnostics
401-Aqua Corridor,
Beside Star Bazar, Adajan,
Surat-395009. Mo. 9825947712


Dr. Shivangi Gandhi:
M.B.B.S, M.D (Pathology)

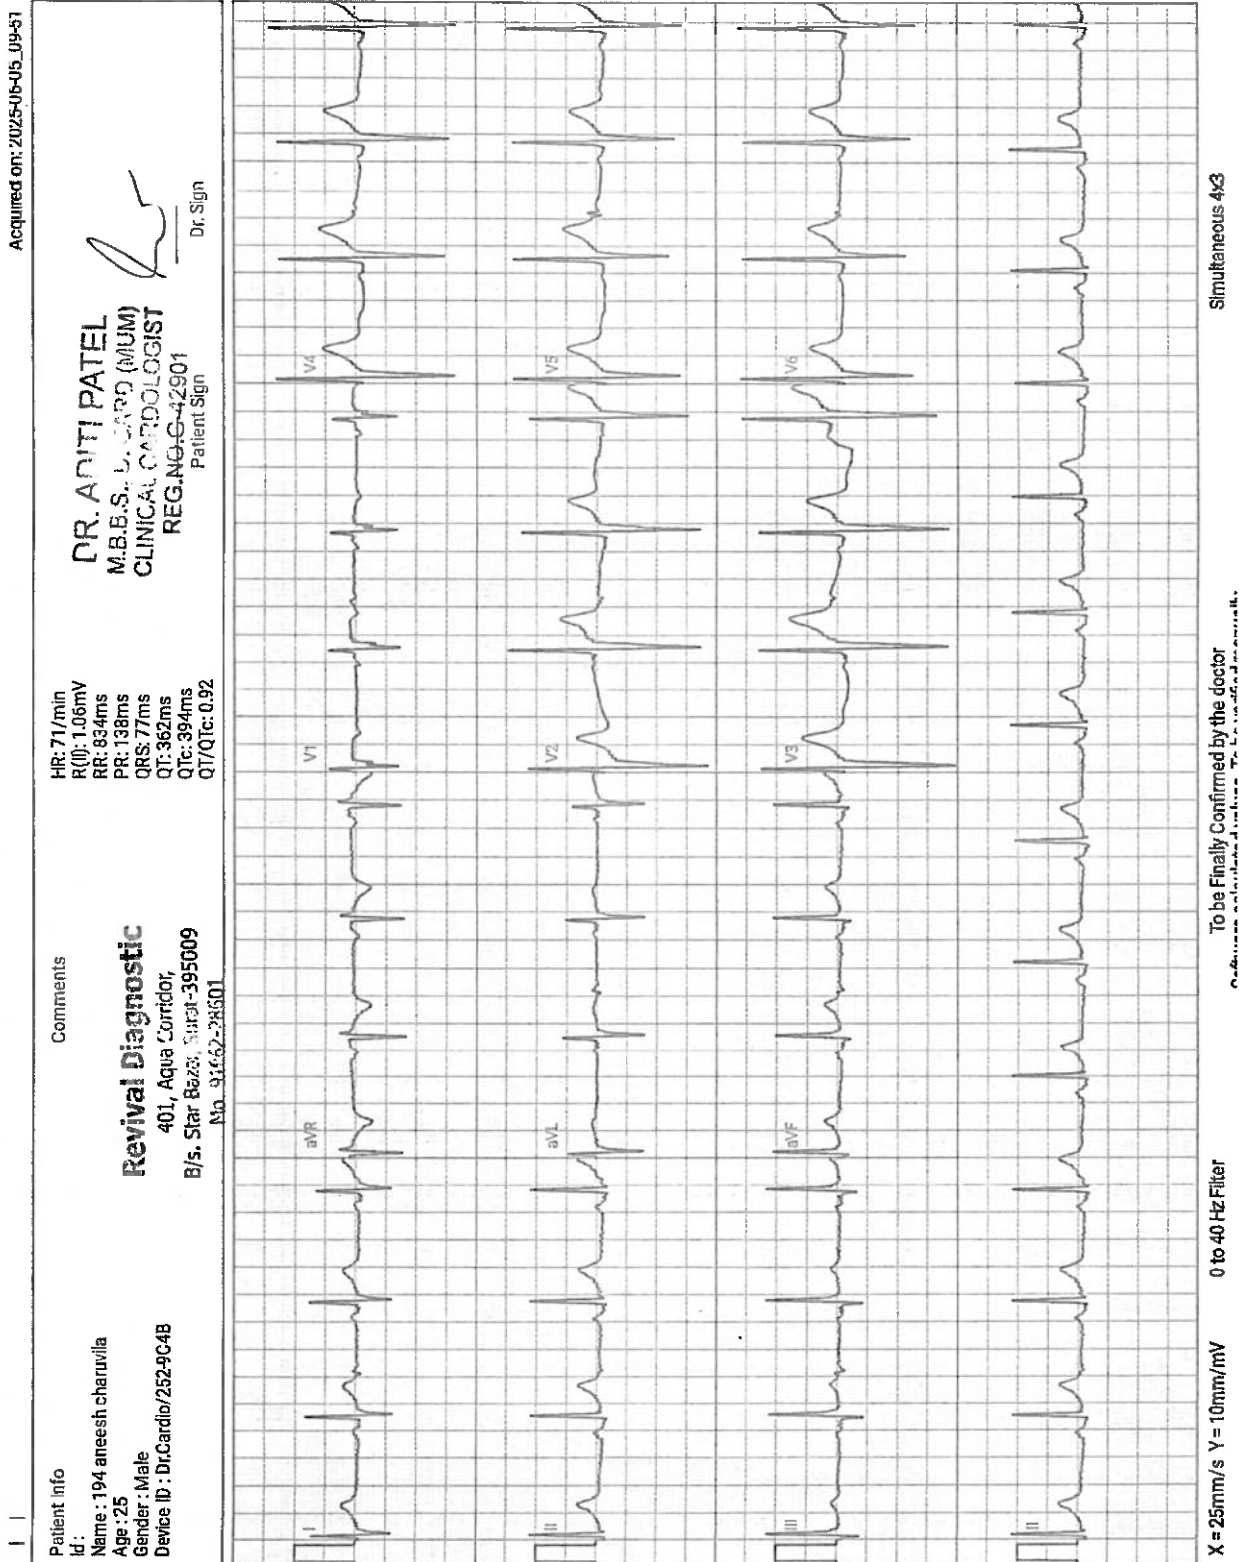
Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)



Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Aneesh Kunjumon Charuvila(AS194/02)

<http://100.168.0.220/ServiceCenter/Print.aspx?ID=1&Type=PrintRe...>

REVIVAL
DIAGNOSTICS



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	04-Jun-2025 06:55 PM

ECG

1. The rhythm is sinus.
2. Heart rate is 71 beats per minute.
3. Normal P,QRS,T wave axis.
4. Normal PR,QRS,Q.T. Duration.
5. No pathological q wave or ST-T changes seen.
6. No evidence of chamber hypertrophy or enlargement seen.

IMPRESSION : ECG WITHIN NORMAL LIMITS

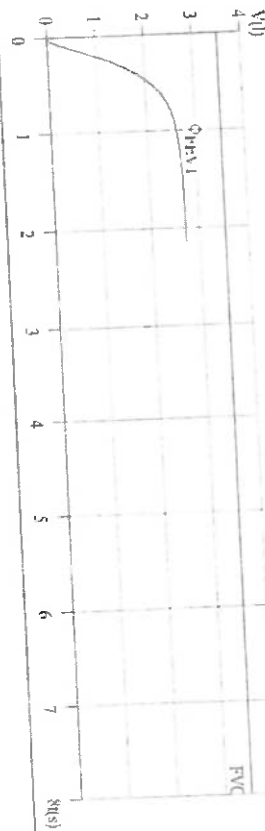
Revival Diagnostic
401, Aqua Corridor,
B/s. Star Bazar, Surat-395009
Mo. 91062-28601


DR. ADITI PATEL
M.B.B.S., D.CARD(MUM)
CLINICAL CARDIOLOGIST
REG. NO: G-42901

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.
0261 2747768, 9825947712 revivaldiagnostics.surat@gmail.com www.revivaldiagnostics.com
This medical report is not intended for medico-legal purposes.

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)


$$= \Gamma_1 \Gamma_2 \Gamma_3 \Gamma_4 = \frac{1}{4} \log \frac{1}{1 - \frac{1}{2} \frac{1}{2} \frac{1}{2} \frac{1}{2}}$$


Parameter (L)	Pred.	Post	%Pred.
FVC(L)	3.52	2.50	81.2
FEV _{0.5} (L)	—	2.22	—
FEV ₁ (L)	3.01	2.70	91.7
FEV ₁ /FVC%	82.71	90.5	116.7
PEF(L/s)	7.04	7.51	106.7
PFR(L/s)	—	—	—
FEF _{25-75%} (L/s)	3.66	5.71	156
Vmax _{25%} (L/s)	5.98	7.47	124.9
Vmax _{50%} (L/s)	3.93	6.21	158
Vmax _{75%} (L/s)	1.8	3.7	205.6
PET100%(L/s)	—	2.19	—
FLA (Years)	56	64	

INTERPRETATION

Post: Normal Spinal Cord ($\ast$ FEV1/FVC $>80\%$, Pred $\ast$ FEV1/FVC and FVC $>80\%$, PredFVC)

INTERPRETATION

~~Revival Diagnostics~~
Dr. Robert F. Fajana
M.D., C.M.
Medical Officer Regd No G-50107

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

REVIVAL DIAGNOSTICS

ADAJAN

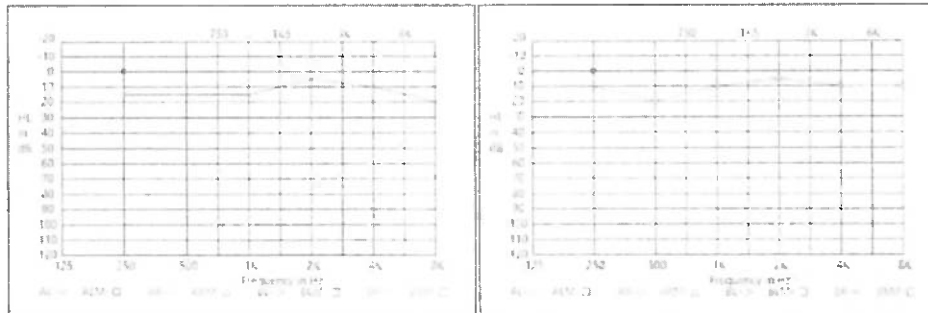
SURAT

Name	Case No.	Age	Sex
ANEESH CHARUVILA	194	25	M
Address		Phone No.	

Date

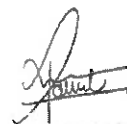
6/4/2025

Referred By



Interpretation

HSNWL


Revival Diagnostics
Dr. Rajendra P. Jha
MBBS, CH
Medical Officer-Regd. No. G-5017

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

6/10/25, 4:49 PM

Aneesh Kunjumon Charuvila(AS194/02)

REVIVAL
DIAGNOSTICS



Name	Aneesh Kunjumon Charuvila	Age/Gender	25Yrs/Male
Reg No.	AS194/02	Receipt No	4174
Referred By	ASIAN PAINTS LIMITED	City	ANKLESHWAR
Collection Type	CAMP	Collection DateTime	04-Jun-2025 06:55 PM

CHEST RADIOGRAPH (PA VIEW)

- Hilar shadows are within normal limits.
- Pulmonary vasculature appears normal.
- Cardiac appears normal in size.
- Both domeh of the diaphragm are smooth.
- Both costophrenic recesses are clear.
- Both lung fields appear normal.
- Visualized bones and soft tissue shadows appear normal.

IMPRESSION: NORMAL STUDY.

DR.CHIRAG K PATEL
RADIOLOGIST

Chirag K. Patel
DR.CHIRAG K PATEL
MBBS - DMRD
Reg. No: G-23509
RADIOLOGIST

Dr. Chirag K. Patel
MBBS-DMRD
Reg. No. G-23509
Revival Diagnostic
4th Floor, Aqua Corridor,
Nr. Star Bazar, Hazira Main Road,
Adajan, Surat-395009.
Mo. 9726672668

Laboratory Test Result are Subject to technical limitation and should be clinically correlate for final diagnosis

9 4th Floor, Aqua Corridor, Hazira Road, Adajan Pal, Surat-395009.

☎ 0261 2747788, 9825947712 ✉ revivaldiagnostics.surat@gmail.com 🌐 www.revivaldiagnostics.com

This medical report is not intended for medico-legal purposes.

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India
HALF YEARLY EC COMPLIANCE REPORT FY25-26 (Apr'25 - Sep'25)

Annexure P

Six monthly noise report



POLLUCON LABORATORIES PVT. LTD.

TEST CERTIFICATE FOR NOISE MONITORING

05/7.8/87-EX

Page: 1 of 1

Customer's Name and Address :

M/s. ASIAN PAINTS LIMITED
2602, GIDC, INDUSTRIAL ESTATE,
ANKLESHWAR - 393 002
TEL NO. (02646) 678 000

Test Report No. : PL/AP /25/07/0024

Issue Date : 19/07/2025

Customer's Ref. : PO. No. 0025385354 Date: 31/03/2024

Date of Sampling : 08/07/2025
Test Method : IS 9889
Sampling Location : As per table
Sampling By : Pollucon Laboratories Pvt. Ltd.

RESULT TABLE

SR. NO.	SAMPLING LOCATION	OBSERVATION	
		Day Time dB(A)	Night Time dB(A)
1	Near Gate No. 1	62.3	50.7
2	Near Admin Building	66.9	45.9
3	Near Canteen	57.1	45.1
4	Near ETP	70.9	62.1
5	Near Distribution Center	66.3	53.6
6	Incinerator Area	59.1	48.7
7	Contractor's Workshop	67.1	57.9
8	Near Gate No.3	62.1	60.9
9	Barrel Cleaning Area	61.3	54.2
GPCB LIMIT*		75 dB(A)	70 dB(A)

*As per government order No. 1000-111883-16 dt. 15.06.2016. Under Ministry of Environment and Forests, Govt. of India.
Day time the limit is from 06.00 a.m. to 12.00 p.m.
Night time the limit is from 10.00 p.m. to 06.00 a.m.

Ravi Jariwala
Sr. Environmental Scientist

Dr. Arun Bajpai
Lab Manager(Q)

Accredited by NABL New Delhi under ISO 17025 for Environmental (Physics) and ISO 9001 for Quality Management System (Schedule II activities) ISO 14001:2015 ISO 45001:2018

*Pollucon Labs Pvt. Ltd., Plot No 5.8, Opp. Dalaji Industrial Society, Old Shantirath Sdk Mill Lane, Near Geyth Farnan Mart,
Nagivan Circle, Jethara Magdalla Road, Surat-393007, Gujarat, India

Phone: 0261-2637758, 0261-2635751, 0261-2634775, 0781825574, Web: www.polluconlab.com, E-mail: polucon@gmail.com, info@polluconlab.com

Asian Paints Ltd

Plot No 2702, 2703, 2602 to 2607 & 2609 to 2614 + 2701 A + 2701B,
GIDC Ind Estate, Ankleshwar 393002, Dist: Bharuch, Gujarat, India

HALF YEARLY EC COMPLIANCE REPORT_FY25-26 (Apr'25 - Sep'25)

Annexure Q

Solar data

Month	Solar power harvested within factory (in KWH)
Apr-25	34
May-25	0
Jun-25	0
Jul-25	76355
Aug-25	109530
Sep-25	98815
Total	284734

